

McKechnie Aluminium Solutions Limited
Monitoring Programme
Annual Report
2012-2013

Technical Report 2013 - 91

ISSN: 0144-8184 (Print)
ISSN: 1178-1467 (Online)
Document: 1305726 (Word)
Document: 1317004 (Pdf)

Taranaki Regional Council
Private Bag 713
STRATFORD

March 2014

Executive summary

McKechnie Aluminium Solutions Limited operates an aluminium melting and extrusion plant located at Bell Block, in the Mangaone and Mangati catchments. Processing of copper and brass (copper/zinc) at the metal melting and extrusion plant ceased in June 2002 and January 2003 respectively. The Company holds resource consents to allow it to discharge into the Mangaone and Mangati streams, and to discharge emissions into the air. This report for the period July 2012-June 2013 describes the monitoring programme implemented by the Taranaki Regional Council to assess the Company's environmental performance during the period under review, and the results and environmental effects of the Company's activities.

The Company holds a total of two resource consents that are covered within this particular report: consent 1857 to discharge stormwater into an unnamed tributary of the Mangaone Stream, and consent 4034 to discharge emissions into the air, which together include a total of 22 conditions setting out the requirements that the Company must satisfy. Water permit 3139 is also held by McKechnie Aluminium Solutions Limited, but is reported on separately within the Mangati Catchment Annual Monitoring Report.

The Council's monitoring programme for the year under review included three site inspections, 14 water samples collected for physicochemical analysis, two biomonitoring surveys of receiving waters, and one deposition gauge survey in the vicinity of the foundry site.

During the 2012-13 year, the Company demonstrated a high level of environmental performance and compliance with the resource consents. There were no Unauthorised Incidents (UI/s) recording non-compliance in respect of this consent holder. The site was well managed and general housekeeping on site was excellent. The Stormwater Management Plan was adhered to. As in the previous monitoring period, sampling showed slight improvements in water quality in relation to dissolved copper and dissolved zinc concentrations. This supports the trend from previous sampling of an improvement in water quality within the receiving environment.

Biomonitoring results have also continued to indicate a slight improvement in water quality and ecological conditions in the stream over the last few years. MCI and SQMCI_s scores indicate that treated stormwater discharged from the site is not having a detrimental effect on the macroinvertebrate communities of the unnamed tributary.

This report includes recommendations for the 2013-2014 year, including a recommendation relating to the optional review of consents 1857-6 and 4034-3.

Table of contents

	Page
1. Introduction	1
1.1 Compliance monitoring programme reports and the Resource Management Act 1991	1
1.1.1 Introduction	1
1.1.2 Structure of this report	1
1.1.3 The Resource Management Act (1991) and monitoring	2
1.1.4 Evaluation of environmental and consent performance	2
1.2 Process description	3
1.1.1 Discharges to stormwater	3
1.1.2 Discharges to air	5
1.3 Resource consents	6
1.3.1 Water discharge permit	6
1.3.2 Air discharge permit	7
1.4 Monitoring programme	8
1.4.1 Introduction	8
1.4.2 Programme liaison and management	8
1.4.3 Site inspections	8
1.4.4 Chemical sampling	9
1.4.5 Biomonitoring surveys	9
2. Results	11
2.1 Water	11
2.1.1 Stormwater management plan	11
2.1.2 Inspections	11
2.1.3 Results of discharge and receiving water monitoring	12
2.1.4 Biological monitoring of receiving waters	15
2.2 Air	16
2.2.1 Inspections	16
2.2.2 Deposition dust gauging	17
2.3 Investigations, interventions, and incidents	19
3. Discussion	20
3.1 Discussion of site performance	20
3.2 Environmental effects of exercise of consents	20
3.2.1 Environmental effects of exercise of water discharge permit	20
3.2.2 Environmental effects of exercise of air discharge permit	20
3.3 Evaluation of performance	21
3.4 Recommendations from the 2010-2012 Report	22
3.5 Alterations to monitoring programme for 2013-2014	23
3.6 Exercise of optional review of consents	23
4. Recommendations	24

Glossary of common terms and abbreviations	25
Bibliography and references	27
Appendix I Resource consents held by McKechnie Aluminium Solutions Limited	
Appendix II Biomonitoring reports	

List of tables

Table 1	Results of routine monitoring conducted by the Taranaki Regional Council during the 2012-2013 year	13
Table 2	Summary of combined discharge [STW001027] and receiving water [MGO000031] monitoring results for the 2012-2013 year	14
Table 3	Foundry deposition gauge results for the 1 Nov – 21 Nov 2012 survey	18
Table 4	Summary of performance for Consent 1857-6 to discharge treated stormwater into the Mangaone Stream	21
Table 5	Summary of performance for Consent 4034-3 to discharge emissions into the air	22

List of figures

Figure 1	MAS Ltd foundry site, showing the boundary between Mangaone and Mangati stream catchments and water monitoring sites	4
Figure 2	Location of MAS Ltd plant at Bell Block showing Council water monitoring sites	10
Figure 3	Locations of dust deposition monitoring sites	17

List of Photos

Photo 1	MAS Ltd Baghouse, 2006	5
---------	------------------------	---

1. Introduction

1.1 Compliance monitoring programme reports and the Resource Management Act 1991

1.1.1 Introduction

This report is the Annual Report for the period July 2012-June 2013 by the Taranaki Regional Council on the monitoring programme associated with resource consents held by McKechnie Aluminium Solutions Limited [MAS Ltd]. The Company operates an aluminium foundry and extrusion process situated at Paraite Road, in the Mangaone and Mangati catchments. The location of the site is shown in Figures 1 and 2 below.

Copper and brass foundries and extrusion processes had previously been operated at the site. Copper processing ceased in June 2002 and brass processing ceased in January 2003. MAS Ltd also previously operated a separate powdercoating facility on Connett Rd in the Mangati catchment. This operation was shifted to the main Paraite Rd site during the 2008-2009 year and is now monitored under the existing consents for this site.

This report covers the results and findings of the monitoring programme implemented by the Council in respect of the consent held by MAS Ltd that relates to discharges of water within the Mangaone catchment [1857]¹. This report also covers the results of the Council's monitoring programme associated with the air discharge permit held by MAS Ltd to cover emissions to air from the site [4034].

One of the intents of the Resource Management Act (1991) is that environmental management should be integrated across all media, so that a consent holder's use of water, air, and land should be considered from a single comprehensive environmental perspective. Accordingly, the Taranaki Regional Council generally implements integrated environmental monitoring programmes and reports the results of the programmes jointly. This report discusses the environmental effects of Company's use of water and air, and is the twentieth combined annual report by the Taranaki Regional Council for the foundry site.

1.1.2 Structure of this report

Section 1 of this report is a background section. It sets out general information about compliance monitoring under the Resource Management Act and the Council's obligations and general approach to monitoring sites through annual programmes, the resource consents held by MAS Ltd, the nature of the monitoring programme in place for the period under review, and a description of the activities and operations conducted at the Company's site.

Section 2 presents the results of monitoring during the period under review, including scientific and technical data.

¹ Two stormwater discharge permits are held for the MAS Ltd site, consents 1857 and 3139. Consent 3139 (for the discharge of cooling water and stormwater from the MAS Ltd site to the Mangati Stream) is reported separately by the Taranaki Regional Council in a joint report covering discharges within the Mangati catchment.

Section 3 discusses the results, their interpretations, and their significance for the environment.

Section 4 presents recommendations to be implemented in the 2013-2014 monitoring year.

A glossary of common abbreviations and scientific terms, and a bibliography, are presented at the end of the report.

1.1.3 The Resource Management Act (1991) and monitoring

The Resource Management Act primarily addresses environmental 'effects' which are defined as positive or adverse, temporary or permanent, past, present or future, or cumulative. Effects may arise in relation to:

- (a) the neighbourhood or the wider community around a discharger, and may include cultural and social-economic effects;
- (b) physical effects on the locality, including landscape, amenity and visual effects;
- (c) ecosystems, including effects on plants, animals, or habitats, whether aquatic or terrestrial;
- (d) natural and physical resources having special significance (eg, recreational, cultural, or aesthetic);
- (e) risks to the neighbourhood or environment.

In drafting and reviewing conditions on discharge permits, and in implementing monitoring programmes, the Taranaki Regional Council is recognising the comprehensive meaning of 'effects' inasmuch as is appropriate for each discharge source. Monitoring programmes are not only based on existing permit conditions, but also on the obligations of the Resource Management Act to assess the effects of the exercise of consents. In accordance with section 35 of the Resource Management Act (1991), the Council undertakes compliance monitoring for consents and rules in regional plans, and maintains an overview of the performance of resource users and consent holders. Compliance monitoring, including both activity and impact monitoring, enables the Council to continually re-evaluate its approach and that of consent holders to resource management and, ultimately, through the refinement of methods and considered responsible resource utilization, to collectively improve management of the region's resources.

1.1.4 Evaluation of environmental and consent performance

Besides discussing the various details of the performance and extent of compliance by the consent holder during the period under review, this report also assigns an overall rating. The categories used by the Council, and their interpretation, are as follows:

- a **high** level of environmental performance and compliance indicates that essentially there were no adverse environmental effects to be concerned about, and no, or inconsequential (such as data supplied after a deadline) non-compliance with conditions.
- a **good** level of environmental performance and compliance indicates that adverse environmental effects of activities during the monitoring period were negligible or

minor at most, or, the Council did not record any verified unauthorised incidents involving significant environmental impacts and was not obliged to issue any abatement notices or infringement notices, or, there were perhaps some items noted on inspection notices for attention but these items were not urgent nor critical, and follow-up inspections showed they have been dealt with, and any inconsequential non compliances with conditions were resolved positively, co-operatively, and quickly.

- **improvement required (environmental) or improvement required (administrative compliance)** (as appropriate) indicates that the Council may have been obliged to record a verified unauthorised incident involving measurable environmental impacts, and/or, there were measurable environmental effects arising from activities and intervention by Council staff was required and there were matters that required urgent intervention, took some time to resolve, or remained unresolved at the end of the period under review, and/or, there were on-going issues around meeting resource consent conditions even in the absence of environmental effects. Abatement notices may have been issued.
- **poor performance (environmental) or poor performance (administrative compliance)** indicates generally that the Council was obliged to record a verified unauthorised incident involving significant environmental impacts, or there were material failings to comply with resource consent conditions that required significant intervention by the Council even in the absence of environmental effects. Typically there were grounds for either a prosecution or an infringement notice.

For reference, in the 2012-2013 year, 35% of consent holders in Taranaki monitored through tailored compliance monitoring programmes achieved a high level of environmental performance and compliance with their consents, while another 59% demonstrated a good level of environmental performance and compliance with their consents.

1.2 Process description

1.1.1 Discharges to stormwater

The MAS Ltd manufacturing plant extends across the boundary between two stormwater catchments (Figure 1). Drainage from the western side (3.9 hectares) is to the eastern headwaters of the Mangaone Stream, about four kilometres from where the stream enters the Waiwhakaiho River. Drainage from the eastern side (4.9 hectares) is to the Mangati Stream. There are separate consents for stormwater discharges to the two catchments. This report relates to the western stormwater discharge. The eastern stormwater discharge, consent 3139, is monitored under the Mangati Stream Catchment Monitoring Programme.

The area which drains to the Mangaone catchment is bounded by the Marton – New Plymouth railway, Henwood Road, and the main building. Significant changes have occurred at the site during the last fifteen years with respect to both processing activities undertaken at the site and improvements to control the effects of historical activities. An outline of the historical activities and their potential impacts on current stormwater quality is given below. More detailed discussions are contained in previous monitoring reports, which are listed in the bibliography.

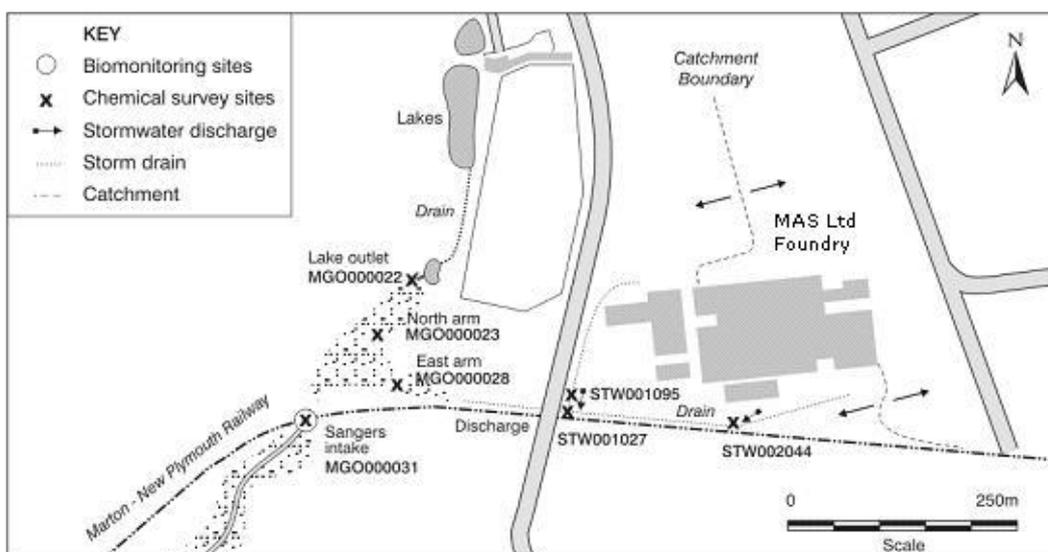


Figure 1 MAS Ltd foundry site, showing the boundary between Mangaone and Mangati stream catchments and water monitoring sites

Approximately 40% of the site draining to the Mangaone catchment is planted, 16% roofed, 41% tar seal or concrete, and 3% bare gravel.

The estimated storm flow to the Mangaone system, for a 10-minute duration event of 5 year return period, is 670 litres per second. Currently, for consent compliance purposes, the discharge point is at Henwood Road railway crossing. Monitoring is also undertaken at the points of exit from the site.

Aerial emissions from the now defunct brass and copper foundry and swarf drying plant prior to the installation of the baghouse in 1996, have contributed to the significant concentrations of metals, particularly copper, zinc and lead, now found in the surface soils at the site. Historical practices relating to the handling and storage of scrap, dross and baghouse dust have also resulted in particular areas having elevated metals concentrations.

Included in the Mangaone catchment are a tool room, fabrication shops, an aluminium anodising plant, an anodising effluent treatment plant, and a powdercoating facility. Also in this catchment are areas previously used in relation to the copper and brass re-melting and extrusion activities, which are now used for aluminium scrap sorting, finishing and warehousing.

A Stormwater Management Plan developed by the Company identifies actions that MAS Ltd has already carried out and is continuing to undertake to minimise the potential for contaminants to enter the stormwater from current operating practices and historical contamination. The progress the Company has made with the action items discussed in the plan is covered in section 2.1.1 of this report.

There are two main stormwater drains westward from the site, which converge immediately above the railway crossing.

The southern drainage ditch runs approximately parallel with the railway, starting outside the former swarf drying plant and brass foundry. Its catchment includes a bunded holding area for drummed waste substances. The drainage from this area is

discharged via a piped system which incorporates a baffled sediment and oil trap. A stop valve is fitted just downstream of the trap allowing isolation of the discharge in the event of a spillage in this catchment.

The western drain services the area around the aluminium anodising plant and fabrication building. The anodising effluent treatment plant is contained within a bunded area. The stormwater discharges to a small swamp in the eastern headwaters of the Mangaone Stream, about four kilometres from where the stream enters the Waiwhakaiho River further west. The swamp is fed from groundwater seeps and from a small lake on the property of the Pacific International Hotel Management School on Henwood Road. This area was redeveloped during the creation of the SH3 Bell Block bypass. Transit NZ holds consents for the reclamation of part of the northern end of the lake [5801] and to discharge stormwater from road surface drainage into the lakes [5803].

1.1.2 Discharges to air

In January 2008, a reconditioned gas fired furnace was installed which replaced the previous gas fired melting and holding furnaces. Only clean scrap is loaded into the new gas furnace, which discharges directly to atmosphere through a separate stack.

The Company receives clean in-house production and purchased scrap aluminum extrusions and ingots for re-melting and casting into extrusion log. A small amount of fumeless cleaning flux is used during the melting process. Small additions of silicon and magnesium are made to the aluminum in the gas fired furnace after it is melted for alloying purposes. The furnace burners are turned to low during dross removal, which combined with the fumeless flux, means that there are no emissions generated. No toxic metals are used during the melting process.



Photo 1 MAS Ltd Baghouse, 2006

Before the aluminum is cast, further fumeless cleaning flux is used, along with casting table and launder coating applications. Continuous lubricant is injected into molds during the casting process.

Anodised and powdercoated scrap is chopped for loading into a separate induction furnace where emissions are routed to the aluminum baghouse. A fumeless cleaning flux is used after melting, followed by dross removal with the melt then being transferred to the gas fired furnace.

Discharges to air from the powdercoating facility are monitored under the foundry site consent [4034]. The potential effects from powdercoating are emissions of powder and odours into the air from the process. If solvents are used in the process there is also potential for air emissions to contain a toxic component. These effects can all be avoided by appropriate technology; and in this case an exhaust fan followed by a baghouse is used. This technology is simple, robust and effective.

During past monitoring periods, there were frequent, but intermittent, plume discharges from the various sources to air. These varied in their impact offsite, depending on processing and weather conditions at the time of emission. Fugitive emissions have not been noted from vents on the aluminium building roof in recent monitoring periods. The baghouse controls have pre-set temperature limits, which will divert the exhaust gases directly to the stacks if the incoming gases exceed the limits set. This avoids the superheated gases damaging the baghouse or its components. This type of discharge is still subject to conditions 1 and 2 of consent 4034-3, which require the consent holder to adopt the 'best practicable option' to minimise adverse effects upon the receiving environment from the discharges.

1.3 Resource consents

1.3.1 Water discharge permit

Section 15(1)(a) of the Resource Management Act stipulates that no person may discharge any contaminant into water, unless the activity is expressly allowed for by a resource consent or a rule in a regional plan, or by national regulations.

McKechnie Aluminium Solutions Limited holds water permit **1857-6** to discharge treated stormwater from an industrial premise that includes a metal extrusion plant into an unnamed tributary of the Mangaone Stream. This permit was issued by the Taranaki Regional Council on 4 December 2012 under Section 87(e) of the Resource Management Act. It is due to expire on 1 June 2026.

There are nine special conditions imposed on consent 1857-6.

Condition 1 requires that the consent holder adopts the best practicable option to prevent or minimise any adverse effects on the environment.

Condition 2 limits the catchment area of the discharge to 4 hectares.

Condition 3 requires that hazardous substance storage areas are isolated from the stormwater catchment.

Condition 4 specifies limits for the components within the discharge immediately downstream of the railway crossing culvert.

Condition 5 establishes a mixing zone of 150 metres extending from below the railway crossing culvert, beyond which compliance with section 107 of the RMA is required.

Condition 6 requires that MAS Ltd maintain a contingency plan for action to be taken in the event of accidental discharge or spillage of contaminants.

Condition 7 requires the maintenance of a stormwater management plan to the satisfaction of the Council.

Condition 8 requires the consent holder to notify the Council prior to making changes at the site which may alter the nature of the discharge.

Condition 9 provides for review of the consent.

The permit is attached to this report in Appendix I.

1.3.2 Air discharge permit

Section 15(1)(c) of the Resource Management Act stipulates that no person may discharge any contaminant from any industrial or trade premises into air, unless the activity is expressly allowed for by a resource consent, a rule in a regional plan, or by national regulations.

McKechnie Aluminium Solutions Limited holds air discharge permit **4034-3** to cover the discharge of emissions into air from the smelting of non-ferrous metals and associated processes. This permit was first issued by the Taranaki Regional Council on 8 September 1993 as a resource consent under Section 87(e) of the Resource Management Act. It was most recently renewed on 15 August 2008 and is due to expire on 1 June 2026.

There are thirteen special conditions imposed on consent 4034-3.

Conditions 1 and 2 require that the consent holder adopts the best practicable option to prevent or minimise any adverse effects on the environment.

Condition 3 stipulates that any discharge to air shall not give rise to offensive or toxic levels of smoke, dust or odour at or beyond the site boundary.

Conditions 4, 5 and 6 limit the dust deposition rate beyond the site boundary; the total particulate matter concentration of ventilated gas streams; and the effect of discharges on the ambient suspended particulate concentration at the site boundary.

Condition 7 requires the consent to be exercised in accordance with the consent holder's Environmental Management Manual.

Condition 8 requires the consent holder to notify the Council prior to making any changes at the site which may alter the nature of the discharge.

Conditions 9, 10 and 11 stipulate limits on the opacity of any discharge; the increase in the ground level PM₁₀ concentration beyond the boundary due to site discharges; and the concentration of any other contaminants in the discharge not specifically named in this consent.

Condition 12 requires the consent holder to immediately notify the Council of any incident or situation that does not comply with this consent, and to supply a written report on the incident to the Council within one week.

Condition 13 provides for review of the consent.

The permit is attached to this report in Appendix I.

1.4 Monitoring programme

1.4.1 Introduction

Section 35 of the Resource Management Act sets out obligation/s upon the Taranaki Regional Council to gather information, monitor, and conduct research on the exercise of resource consents, and the effects arising, within the Taranaki region and report upon these.

The Taranaki Regional Council may therefore make and record measurements of physical and chemical parameters, take samples for analysis, carry out surveys and inspections, conduct investigations, and seek information from consent holders.

The monitoring programme for the MAS Ltd site consisted of four primary components.

1.4.2 Programme liaison and management

There is generally a significant investment of time and resources by the Taranaki Regional Council in ongoing liaison with resource consent holders over consent conditions and their interpretation and application:

- in discussion over monitoring requirements
- preparation for any reviews
- renewals
- new consents
- advice on the Council's environmental management strategies and content of regional plans and
- consultation on associated matters.

1.4.3 Site inspections

The MAS Ltd site was visited three times during the monitoring period. With regard to the consent for the discharge to water, the main points of interest were plant processes with potential or actual discharges to receiving watercourses, including contaminated stormwater and process wastewaters. Air inspections focused on plant processes with associated actual and potential emission sources and characteristics, including potential odour, dust, noxious or offensive emissions. Sources of data being collected by the consent holder were identified and accessed, so that performance in respect of

operation, internal monitoring, and supervision could be reviewed by the Council. The neighbourhood was surveyed for environmental effects.

1.4.4 Chemical sampling

The Council undertook sampling of the discharge from the site for the purpose of compliance monitoring, and surveyed the water quality upstream and downstream of the discharge point and mixing zone to determine the impact on the receiving water.

There are eight permanent chemical monitoring sites (as shown in Figures 1 and 2). These are the western and eastern discharge points; the discharge drain at Henwood Rd; the lake outlet upstream of the stormwater discharge; the northern arm of the swamp upstream of the discharge; the eastern arm of the swamp which receives the discharge (just inside the mixing zone); the receiving water in the unnamed tributary; and the receiving water in the Mangaone Stream at Egmont Rd.

One monitoring run is carried out annually in wet weather, for compliance monitoring of the stormwater discharge, and one run is carried out annually in dry weather, to determine long term trends in the quality of the receiving water. Samples are analysed for pH, conductivity, suspended solids and concentrations of total and dissolved copper and zinc. The results of this monitoring are presented in Table 1.

In addition, one reduced wet weather sampling run was undertaken to assess the relative levels of dissolved copper and zinc in the combined discharge and the receiving water below the mixing zone. The results are included in Table 2.

To assess levels of particulate emissions to air, deposition gauges were placed in the vicinity of the site on one occasion during the period under review and the collected samples were analysed for deposited particulates and selected metals.

1.4.5 Biomonitoring surveys

Biological surveys were performed in November 2012 and January 2013 in an unnamed tributary of the Mangaone Stream to determine whether or not the discharge of stormwater from the site has had a detrimental effect upon the communities of the stream.

The full survey reports are attached in Appendix II.

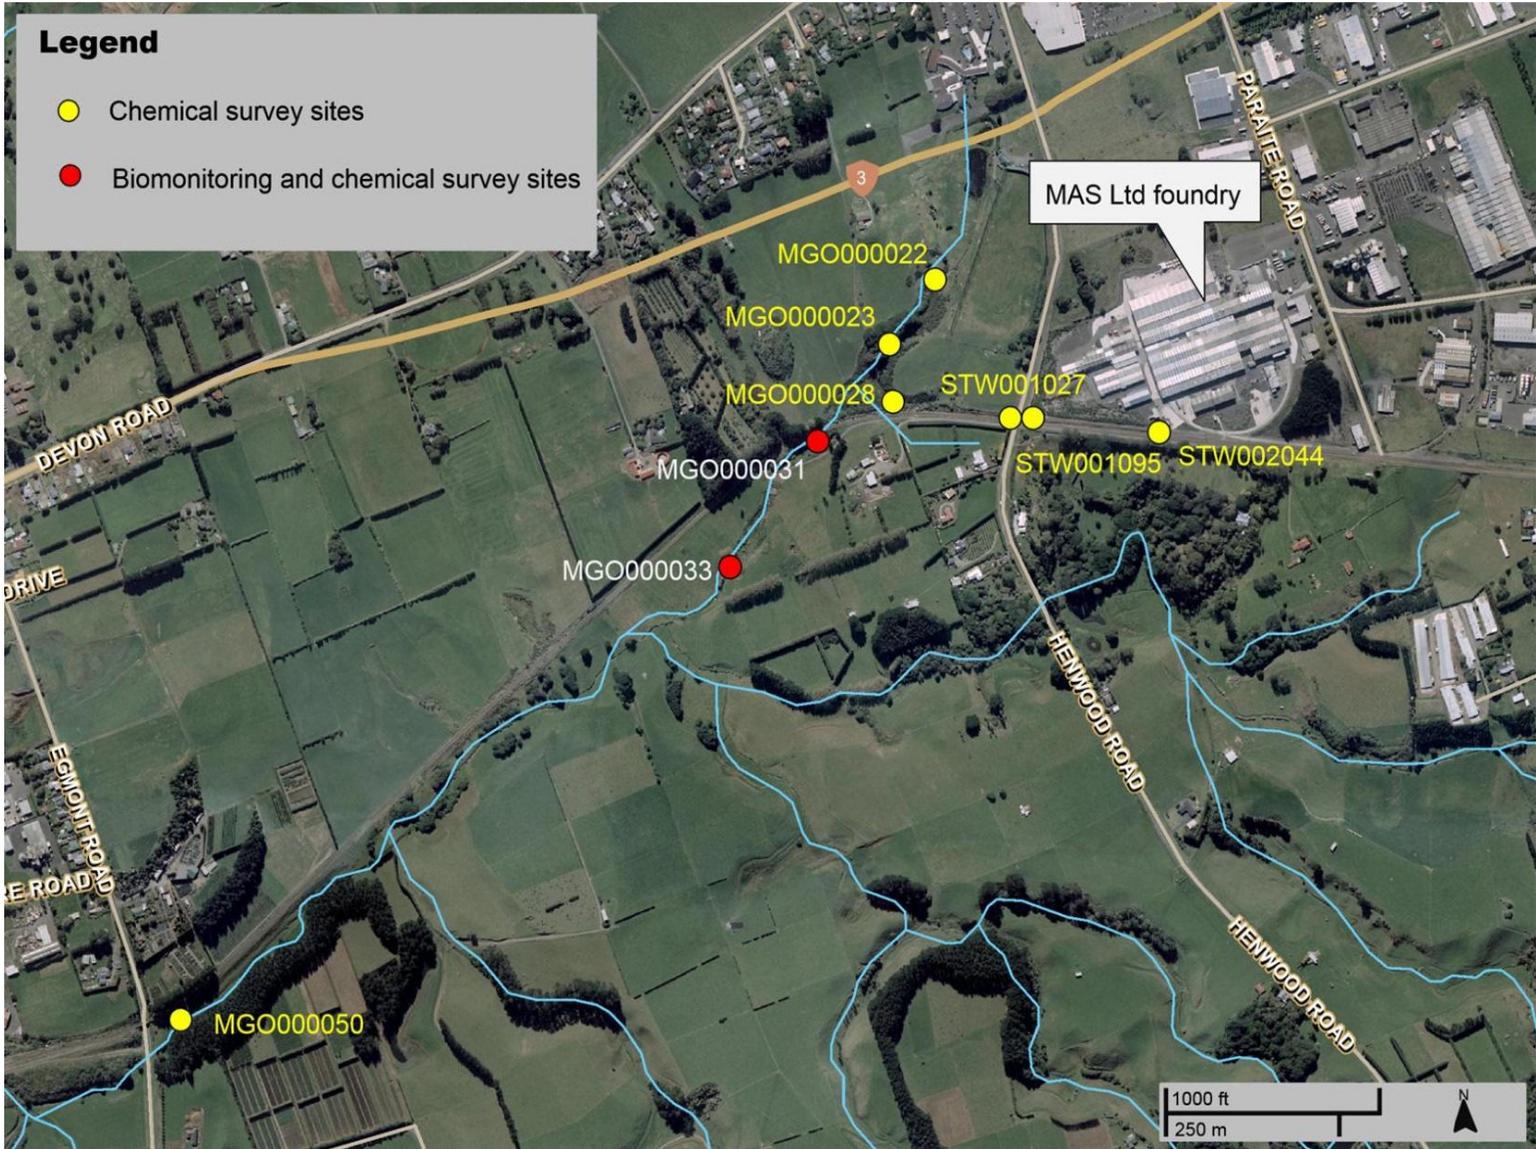


Figure 2 Location of MAS Ltd plant at Bell Block showing Council water monitoring sites

2. Results

2.1 Water

2.1.1 Stormwater management plan

A comprehensive Stormwater Management Plan was received by Council in the 2000-2001 monitoring period, which addressed both current and historical issues impacting on the site's discharges to the Mangati and Mangaone streams. The Company adopted a combined approach aimed primarily at elimination or minimisation at source, but also encompassing settlement devices.

Changes in management practices or engineering solutions were implemented to address current activities where there is a potential for the discharge of contaminants. Where possible, the soils containing elevated levels of toxicants as a result of historical activities were immobilised on site by either covering or by curbing and planting as appropriate.

A significant commitment was required to progress the upgrades outlined in the plan, and therefore the improvements were staged over a number of years with initial projects targeting issues with the highest potential for adverse effects. The majority of the control measures identified were completed by the end of 2005. A stormwater quality monitoring programme aimed at identifying, isolating, managing and assessing improvements to the quality of discharges from the site was also incorporated into the plan.

The progress the Company made each year in addressing the matters identified in the Stormwater Management Plan is detailed in earlier monitoring reports listed in the bibliography. Due to concerns raised by Council about the possible effects on stormwater quality, the removal of the pine trees from the south east corner of the site was staggered. The final phase of this project was due for completion in March 2010. However, due to budgetary concerns, the tree removal and replanting programme was deferred until the 2011-2012 year. This change to the original programme was approved by the Council. Undertaking this activity over a number of years has allowed MAS Ltd to have greater control over the sediments released from the area.

The tenth revision of the Stormwater Management Plan became effective on 25 May 2010. Observations and discussions at inspections that relate to the stormwater management plan are contained in the following section.

2.1.2 Inspections

18 January 2013

All bunded areas were free of spills and clean. The fuel tanks and drums were all secure and no spills were observed. All traffic areas were clean and free of obstructions. Some scrap aluminium was stored outside waiting to be melted down. This scrap was clean. The spill kits were stocked and easily accessed. Drains and water catchment areas appeared to be clean. Yard areas in the Mangaone catchment were clean and free of obstructions. Vegetated areas appeared to be healthy. The yard is swept regularly and was clean at the time of inspection.

11 June 2013

The yard was clean and in good order. A forklift was loading a large pile of clean aluminium into metal bins. All stormwater drains were clear and tidy. Spill kits and bunded areas were secure. Everything was satisfactory at the time of inspection.

26 June 2013

The site was clean and tidy. All the stormwater drains on the boundary were clear.

2.1.3 Results of discharge and receiving water monitoring

Samples were taken by the Council from several permanent sampling points under dry conditions on 10 January 2013 and in wet weather conditions on 17 June 2013. The results are presented in Table 1. A reduced wet weather run was conducted on 20 June 2013. A summary of the combined discharge and receiving water results is given in Table 2.

Dry weather runs are intended to determine long term trends in the quality of the receiving water. Historical metals concentration data available for dry weather runs was limited prior to the introduction of regular sampling at the start of the 1999-2000 monitoring period.

Wet weather runs enable the Council to determine whether compliance with the discharge conditions on consent 1857-6 is being achieved, and what effects the discharge is having on the receiving waters.

Up until a consent renewal in September 2003 there were six prescribed control limits imposed upon the MAS Ltd stormwater discharge. These limits applied to the pH, suspended solids, oil and grease, and copper, lead and zinc concentrations. From September 2003 to the end of the 2012 monitoring period the three prescribed control limits imposed on contaminants were for pH, oil and grease, and suspended solids. The current version of the consent also includes a limit on dissolved copper in the combined discharge of 0.05 g/m³ and 1 g/m³ for dissolved zinc.

The consent also limits the effects that the discharge may have on the receiving water beyond a mixing zone extending 150m from where the discharge enters the swampy area. Site MGO000028 is within this mixing zone.

Traditionally, the establishment of water quality criteria has been based upon the use of measures such as "total recoverable metals" for determining acceptable limits for metal concentrations in discharges. However, in recent years a number of countries including the United States (under the aegis of the USEPA) have revised their toxicant criteria towards the protection of freshwater aquatic ecosystems in the receiving environment, and as such dissolved metal concentrations are considered more representative of the bioavailable fraction of metals in the water column.

The receiving water quality criteria for dissolved copper and zinc, in water with hardness of 50 g/m³ CaCO₃, are 0.0062 g/m³ Cu and 0.058 g/m³ Zn for chronic (long-term) exposure. The corresponding criteria for acute (1-hour) exposure are 0.0088 g/m³ Cu and 0.064 g/m³ Zn. Chronic exposure criteria are best related to dry weather sampling results, whilst acute exposure criteria are best related to wet weather sampling conditions.

Table 1 Results of routine monitoring conducted by the Taranaki Regional Council during the 2012-2013 year

Parameter	Discharge			Downstream			Upstream	
	Western Drain	Eastern Drain	Combined Discharge	East Arm	Sanger's Intake	Egmont Road	North Arm	Lake Outlet
Site code	STW001095	STW002044	STW001027	MGO000028	MGO000031	MGO000050	MGO000023	MGO000022
Dry Run – 10 January 2013								
Temperature (degC)	-	-	-		17.4	18.2	19.4	20.3
Conductivity (mS/m)	-	-	-		20.8	20.3	21.8	10.1
pH	-	-	-		7.0	7.2	6.9	6.9
Suspended Solids (g/m ³)	-	-	-		2	< 2	2	6
Cu Acid Soluble (g/m ³)	-	-	-	(No flow to sample)	< 0.01	< 0.01	< 0.01	< 0.01
Cu Dissolved (g/m ³)*	-	-	-		< 0.001	< 0.001	< 0.001	< 0.001
Zn Acid Soluble (g/m ³)	-	-	-		0.011	< 0.005	0.005	0.016
Zn Dissolved (g/m ³)*	-	-	-		0.008	< 0.005	0.005	< 0.005
Wet Run – 17 June 2013								
Temperature (degC)	14.0	14.2	14.7	15.0	14.1	14.3	14.3	14.0
Conductivity (mS/m)	3.2	6.3	4.3	13.5	11.6	15.5	9.4	6.4
pH	7.0	7.7	7.2	6.4	7.0	7.0	6.8	6.4
Suspended Solids (g/m ³)	< 2	< 2	< 2	< 2	4	9	< 2	4
Cu Acid Soluble (g/m ³)	0.01	0.01	0.02	0.01	< 0.01	< 0.01	< 0.01	< 0.01
Cu Dissolved (g/m ³)*	0.009	0.008	0.024	0.012	0.002	0.001	< 0.001	0.001
Zn Acid Soluble (g/m ³)	0.936	0.056	0.554	0.262	0.027	< 0.005	0.016	0.048
Zn Dissolved (g/m ³)*	0.944	0.05	0.532	0.250	0.026	< 0.005	0.015	0.045
Al Acid Soluble (g/m ³)	< 0.1	< 0.1	< 0.1	-	-	-	-	-
Pb Acid Soluble (g/m ³)	< 0.05	< 0.05	< 0.05	-	-	-	-	-
Oil and Grease (g/m ³)	< 0.5	< 0.5	< 0.5	-	-	-	-	-
*USEPA acute criteria for dissolved metals: Cu 0.0088 g/m ³ and Zn 0.064 g/m ³ [at hardness of 50 g/m ³ CaCO ₃]								

Aside from the dissolved metal concentrations within the mixing zone in the Eastern Arm [MGO000028], none of the samples collected from the tributary of the Mangaone Stream exceeded the relevant USEPA receiving water criteria for the protection of aquatic ecosystems. Most notably, dissolved copper concentrations during the dry weather run were below the detection level of 0.001 g/m³ for all sites in the tributary.

The levels of dissolved copper and zinc found within the mixing zone of the Eastern Arm (MGO000028) were lower than the medians of previous sampling, which are 0.044 g/m³ Cu and 0.45 g/m³ Zn, respectively. There is continuing evidence of an improvement in the water quality of the tributary of the Mangaone Stream in relation to both dissolved copper and dissolved zinc.

The results for all other parameters indicated that the discharge was not having an adverse effect on the receiving waters. Levels of aluminium, lead, oil and grease in the discharge were below detection limits.

The results of combined discharge and receiving water monitoring for the 2012-2013 monitoring period are summarised in Table 2. The monitoring points are the stormwater culvert at the Henwood Road railway crossing (STW001027), which is representative of the total stormwater discharge from the foundry site to the Mangaone catchment, and the unnamed tributary of the Mangaone Stream that is located downstream of the MAS Ltd stormwater discharge point. The second location is shown in Figure 1 and Figure 2 and is referred to as Sanger's Intake (MGO000031)². Two sets of samples were taken during the period under review. All results for dissolved metals in the tributary below the mixing zone were below the USEPA acute receiving water criteria. The discharge was in compliance with consent 1857-6 on both occasions.

Table 2 Summary of combined discharge [STW001027] and receiving water [MGO000031] monitoring results for the 2012-2013 year

Date	Sampling point	Temp (°C)	pH	Conductivity (mS/m)	Suspended Solids (g/m ³)	Oil and Grease (g/m ³)	Dissolved Copper* (g/m ³)	Dissolved Zinc* (g/m ³)
17.6.13	STW001027	14.7	7.2	4.3	< 2	< 0.5	0.024	0.532
	MGO000031*	14.1	7.0	11.6	4	-	0.002	0.026
20.6.13	STW001027	7.8	7.2	5.3	14	< 0.5	0.016	0.783
	MGO000031*	11.9	7.0	10.9	< 2	< 0.5	0.003	0.048

*USEPA acute criteria for dissolved metals: Cu 0.0088 g/m³ and Zn 0.064 g/m³ [at hardness of 50 g/m³ CaCO₃]

The aim of this monitoring was to examine any potential correlation between the levels of dissolved metals in the MAS Ltd discharge and in the tributary of the Mangaone Stream below the mixing zone. This monitoring was instigated during the previous

² Sanger's Intake sampling location is downstream of the stormwater mixing zone. It also provides a useful indication of the overall quality of the receiving water within the unnamed tributary. This is because this particular sampling location is representative of all contributing sources of heavy metals, including several other sources of contaminants that are not directly associated with the stormwater discharge itself.

monitoring periods for the purpose of gathering data to assist in setting practical metals content limits in the Company's renewed stormwater discharge consent.

In interpreting the impact of the discharge on the receiving water at Sanger's intake, a number of other sources of metals not directly associated with the discharge itself that also affect the receiving water must be considered. For example, other sources may include: leaching related to historical aerial contamination from the MAS Ltd site; stormwater run-off from the Bell Block shopping complex and State Highway; earthworks associated with the bypass and industrial area development; and release of metals from the eastern arm associated with historical stormwater discharge activities.

2.1.4 Biological monitoring of receiving waters

The Council's standard 'sweep sampling' technique was used at two established sites to collect streambed macroinvertebrates from an unnamed tributary of the Mangaone Stream on 28 November 2012 and 31 January 2013. The two sites sampled were MGO000031 (site 3) and MGO000033 (site 4) (**Error! Reference source not found.**). Samples were sorted and identified to provide number of taxa (richness) and MCI and SQMCI_s scores.

The MCI is a measure of the overall sensitivity of the macroinvertebrate community to the effects of organic pollution in stony streams. It is based on the presence/absence of taxa with varying degrees of sensitivity to environmental conditions. The SQMCI_s takes into account taxa abundance as well as sensitivity to pollution, and may reveal more subtle changes in communities, particularly if non-organic impacts are occurring, and may be more useful in soft-bottomed streams. Significant differences in either the MCI or the SQMCI_s between sites may indicate the degree of adverse effects (if any) of the discharges being monitored.

28 November 2012

This was the third survey undertaken following a pollution incident that occurred in February 2012, which resulted in a significant fish kill in the Mangaone Stream, and the results of that survey reflected impacts from that pollution incident. (The source of the pollution incident was downstream of and not connected with the MAS Ltd site).

The results of this biological survey indicated that the number of taxa recorded in the community at site 3, a short distance downstream of the stormwater discharge from MAS Ltd was moderate, being only five taxa less than the historical median for this site. The community 400 metres further downstream (site 4) was also relatively typical, having a macroinvertebrate richness two taxa higher than the historical median. This improved richness recorded at the downstream site indicates that the legacy from the urea pollution discharge no longer exists. The richness recorded at site 3 does not indicate an impact from the MAS discharge, but reflects the limited potential for recruitment from upstream, which has poor invertebrate habitat.

The MCI values at both sites were greater than historical medians, with a six unit decrease between sites 3 and 4, which is not a statistically significant difference. In relation to historical survey results, the current survey results were indicative of no recent impacts of discharges on the macroinvertebrate communities of either site.

This macroinvertebrate survey indicated that the discharge of treated stormwater from the MAS Ltd site had not had any detrimental effect on the macroinvertebrate community at site 3 in the unnamed tributary. In addition, it appears that the impacts of the discharge of hydrolysed urea that occurred in February 2011 are no longer present, although the low community richness recorded at site 4 may be a remnant impact from that discharge.

31 January 2013

The results of this biological survey indicated that the number of taxa recorded in the community at site 3, a short distance downstream of the stormwater discharge from MAS Ltd was moderate, being one taxon more than the historical median for this site. The community 400 metres further downstream (site 4) was also relatively typical, having a macroinvertebrate richness two taxa less than the historical median. The taxa richness at site 3 does not indicate an impact from the MAS Ltd discharge, but reflects the limited potential for recruitment from upstream, which has poor invertebrate habitat.

The MCI value at site 3 was five units less than the median for this site, but well within the scores previous recorded. However, this result does represent a large reduction from more recent surveys. The MCI score at site 4 was significantly higher than the median, and that recorded at site 3. It is unlikely the MCI score at site 3 indicates impacts from the stormwater discharge, as this site recorded a relatively healthy SQMCI_s score and community richness. In relation to historical survey results, the current survey results were indicative of no recent impacts of discharges on the macroinvertebrate communities of either site.

With the exception of the February 2006 and April 2007 surveys, the SQMCI_s values have been relatively high in the last 20 surveys. This was due mainly to the high abundances of medium-scoring taxa, particularly 'sensitive' amphipods. This trend was continued in the present surveys at both sites. The generally higher SQMCI_s values in recent surveys may have indicated subtle improvements in the community from that recorded in the late 1990's. Although it is unlikely to be a significant change, it correlates with the improvement shown in the physicochemical water quality monitoring data over this time.

This macroinvertebrate survey indicated that the discharge of treated stormwater from the MAS Ltd site had not had any detrimental effect on the macroinvertebrate community of this unnamed tributary.

2.2 Air

2.2.1 Inspections

18 January 2013

No visible emissions were observed from the foundry or powdercoating operations and no objectionable odours were noted off site.

11 June 2013

No visible emissions or objectionable odours were found during the site inspection.

26 June 2013

No odours were noted at the boundary and no dust issues were found during the inspection.

2.2.2 Deposition dust gauging

Many industries emit dust from various sources during operational periods. In order to assess the effects of the emitted dust, industries have been monitored using deposition gauges. Deposition gauges are buckets elevated on a stand to about 1.6 metres. The buckets have a solution in them to ensure that any dust that settles out of the air is not resuspended by wind.

The rate of dust-fall is calculated by dividing the weight of insoluble material (grams) collected by the cross-sectional area of the gauge (metres²) and the number of days over which the sample was taken. The units of measurement are grams/metre²/day.

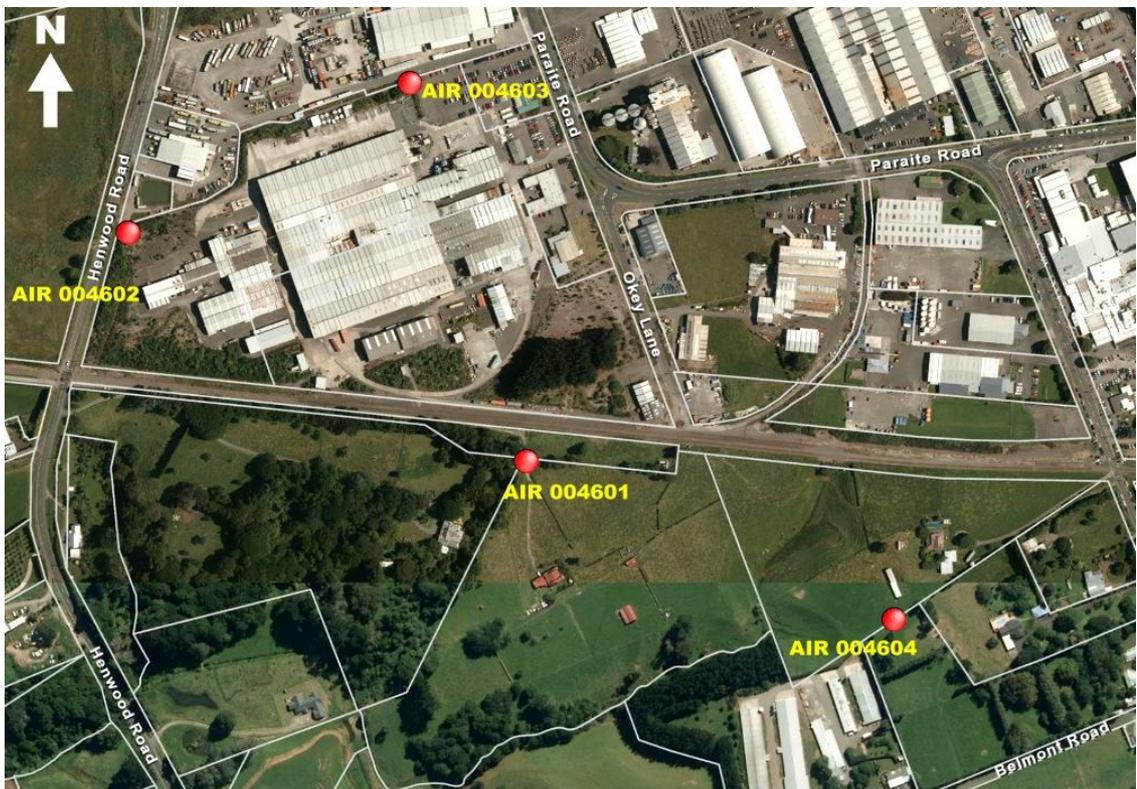


Figure 3 Locations of dust deposition monitoring sites

Guideline values used by the Council for dust deposition are 4g/m²/30 days or 130mg/m²/day deposited matter. Consideration is given to the location of the industry and the sensitivity of the surrounding community when assessing results against these values. Material from the gauges was analysed both for solid particulates and for chemicals associated with pollution including selected metals.

In the 2012-2013 period, gauges were deployed on one occasion at four locations in the vicinity of the foundry site for a period of 20 days. The locations of the monitoring sites around the foundry are shown in Figure 3 above.

Material from the gauges was analysed for particulates, aluminium, copper, lead, zinc and conductivity. For comparison, the median values of data obtained from an urban

'state of the environment' deposition gauge site located on the corner of Mangorei Road and Devon Road (site AIR000012) have been included in Table 3.

Table 3 Foundry deposition gauge results for the 1 Nov – 21 Nov 2012 survey

Site		AIR004601	AIR004602	AIR004603	AIR004604	AIR000012 (median 2000-2003) comparison site
Total particulate mg/m ² /day		20	40	120	50	50
Total particulate mg/m ² /day Median June 1996-June 2012		40	40	100	40	-
Aluminium mg/m ² /day	Dissolved	0.30	0.22	0.25	0.25	-
	Particulate	-*	0.637	1.975	0.382	-
Copper mg/m ² /day	Dissolved	< 0.01	< 0.02	0.03	0.03	0.021
Lead mg/m ² /day	Dissolved	< 0.05	< 0.11	< 0.13	< 0.13	-
Zinc mg/m ² /day	Dissolved	0.17	0.09	0.17	0.14	0.284
Conductivity @ 20°C mS/m/day		0.87	0.68	0.32	1.06	0.28

*erroneous result

Particulates

The rate of particulate deposition was below the 130mg/m²/day guideline value at all monitoring sites, and were similar to the medians of previous sampling results. The elevated deposition rate at site AIR004603 may be explained by its proximity to both the MAS Ltd site and surrounding industrial sites, including a large truck depot.

Metals deposition

The ratio between the particulate and dissolved fractions varies according to the individual metal and the pH of the liquid in the deposition gauge. As much as 99% of the total zinc has been found to be in the dissolved (bio-available) form. This is likely to be higher than the proportion bio-available in the soil, as historically the pH of the liquid in the gauge has been quite acidic (favouring metal solubility) relative to the soil. Because of this, combined with the closure of the copper and brass activities at the site, particulate metal analysis of the filters for copper, lead and zinc has been ceased. The Department of Health (1992) has set guidelines for maximum annual application to agricultural land of heavy metals (in sewage sludge). These guidelines may be used for assessing the impact of metals deposited on land in the vicinity of the MAS Ltd site. The guidelines for copper, lead and zinc are 12, 15 and 30 kilograms per hectare per year, respectively. This equates to 3.3, 4.1 and 8.2 mg/m²/day for copper, lead and zinc respectively. There is no guideline for aluminium.

The highest values recorded for the dissolved metals deposited in the 2012-2013 monitoring year were 0.9%, < 3.1%, and 2.1% of the respective guidelines for copper,

lead, and zinc. The levels of dissolved and particulate aluminium deposition were similar to or lower than the historical median values at all sites.

In comparison to the median values found at the urban 'state of the environment' monitoring site, during the year under review the MAS Ltd deposition gauge sites showed copper and zinc deposition rates that were generally less than or similar to those in an urban area close to a main road.

Other parameters

These results are consistent for those parameters which are predominantly affected by the proximity of a monitoring site to the sea, i.e. total dissolved salts (indicated by conductivity). Activities at the MAS Ltd site do not lead to significant emissions of these compounds, and there is no evidence from the monitoring of site-specific effects related to total dissolved salts.

2.3 Investigations, interventions, and incidents

The monitoring programme for the year was based on what was considered to be an appropriate level of monitoring, review of data, and liaison with the consent holder. During the year matters may arise which require additional activity by the Council eg provision of advice and information, or investigation of potential or actual courses of non-compliance or failure to maintain good practices. A pro-active approach that in the first instance avoids issues occurring is favoured.

The Taranaki Regional Council operates and maintains a register of all complaints or reported and discovered excursions from acceptable limits and practices, including non-compliance with consents, which may damage the environment. The Unauthorised Incident Register (UIR) includes events where the company concerned has itself notified the Council. The register contains details of any investigation and corrective action taken.

Complaints may be alleged to be associated with a particular site. If there is potentially an issue of legal liability, the Council must be able to prove by investigation that the identified company is indeed the source of the incident (or that the allegation cannot be proven).

In the 2012-2013 period, it was not necessary for the Council to undertake significant additional investigations and interventions, or record incidents, in association with MAS Ltd's conditions in resource consents or provisions in Regional Plans in relation to the Company's activities during the monitoring period.

3. Discussion

3.1 Discussion of site performance

MAS Ltd has markedly reduced the discharge of contaminants from its foundry site in recent years. The Company achieved compliance with the prescribed consent limits imposed on its discharge permits for the site in the 2012-2013 monitoring period. Good control of emissions from the aluminium foundry was achieved during the year under review. There were no air related complaints received by Council.

The Company has implemented the improvements relating to consent 1857 and the stormwater management programme developed in conjunction with the Council.

As required by consent 1857, significant environmental and discharge monitoring data was conducted in the previous years, providing adequate information for the incorporation of discharge limits within the renewed consent to ensure that copper and zinc loadings in the receiving waters are below the appropriate levels.

3.2 Environmental effects of exercise of consents

3.2.1 Environmental effects of exercise of water discharge permit

Stormwater from the MAS Ltd site has discharged to a small swamp in the headwaters of the Mangaone Stream for a period of over 30 years. The Council has monitored the effects of the discharge and the receiving water since 1982 through both chemical and biological surveys.

Continued improvements in effluent management and housekeeping practices by MAS Ltd have assisted MAS Ltd in reducing the concentrations of contaminants within the stormwater discharged from the site. Sample results during the period under review support the trend of reductions in the levels of contaminants in the receiving water at Sanger's Intake seen during recent years. No samples outside of the mixing zone exceeded the relevant USEPA receiving water criteria for the protection of aquatic ecosystems.

The two biological surveys undertaken during the period under review indicated that the discharge of treated stormwater from the MAS Ltd site had not had any recent detrimental effect on the macroinvertebrate communities of the unnamed tributary of the Mangaone Stream. This provides further evidence that there has been an improvement in physicochemical water quality in recent monitoring years, consistent with the water quality monitoring data.

3.2.2 Environmental effects of exercise of air discharge permit

Atmospheric particulate matter can arise from a number of sources, both natural and from human activity eg, vegetation pollens, smoke and ash, sea spray, dust from soils and paved surfaces, and manufacturing processes. While extremely fine particles may remain floating in the atmosphere for weeks or months, coarser dusts may settle out within timeframes ranging from a few seconds to minutes.

The environmental effects of dusts include loss of visibility, loss of the amenity and aesthetic values of a 'clear sky', irritation to breathing, and soiling of surfaces. It has

been found that background rates of dust deposition in rural areas of New Zealand are typically 0.1-1.5 g/m²/30 days, while in urban areas rates are generally higher, in the range of 0.6-3.0 g/ m²/30 days. From experience, rates above 3-4 g/ m²/30 days tend to lead to complaints by neighbours over the objectionable or offensive nature of dust emissions from particular sources.

Deposition gauging was conducted for the 18th time during the 2012-2013 monitoring period around the foundry site. The results from the gauging indicate that there is an environmentally acceptable level of particulate deposition in the vicinity of the foundry site. The results of the gauging also showed that the levels of deposited metals were much lower than allowed by the Department of Health (1992) guidelines for maximum annual application to agricultural land of heavy metals (in sewage sludge).

The incidence of conspicuously visible emissions has reduced greatly at the foundry site since the installation of the aluminium baghouse. No visible emissions or odour issues were noted during inspections and no complaints were received during the period under review.

3.3 Evaluation of performance

A tabular summary of the consent holder's compliance record for the year under review is set out in Tables 4-5.

Table 4 Summary of performance for Consent 1857-6 to discharge treated stormwater into the Mangaone Stream

Condition requirement	Means of monitoring during period under review	Compliance achieved?
1. Adoption of best practicable option to minimise effects on the environment	Inspections and liaison with consent holder	Yes
2. Maximum catchment size	Site inspections	Yes
3. Appropriate hazardous substance storage	Site inspections	Yes
4. Limits on chemical composition of discharge	Sampling	Yes
5. Discharge shall not cause specified adverse effects beyond mixing zone	Sampling and biomonitoring surveys of the receiving water	Yes
6. Implementation and review of a contingency plan	Reviewed plan submitted as part of the MAS Ltd Environmental Management Manual	Yes
7. Maintenance of a stormwater management plan	Reviewed plan submitted as part of the MAS Ltd Environmental Management Manual	Yes
8. Notification prior to making changes at the site which may alter the nature of the discharge	Notifications and site inspections	Yes
9. Optional review provision	Next option for review in June 2014	N/A
Overall assessment of consent compliance and environmental performance in respect of this consent		High

N/A = not applicable

Table 5 Summary of performance for Consent 4034-3 to discharge emissions into the air

Condition requirement	Means of monitoring during period under review	Compliance achieved?
1. Adoption of best practicable option to minimise effects on the environment	Site inspections	Yes
2. Selection of best practicable equipment and processes	Site inspections	Yes
3. Discharge shall not give rise to offensive or toxic levels of contaminants at the site boundary	Site inspections and discharge monitoring	Yes
4. Limit on dust deposition rate beyond the site boundary	Deposition gauge monitoring	Yes
5. Maximum particulate concentration of discharges	Testing not undertaken during year under review	N/A
6. Limit on elevation of ambient suspended particulate matter concentration	Deposition gauge monitoring	Yes
7. Compliance with the MAS Ltd Environmental Management Manual	Site inspections and liaison with consent holder	Yes
8. Notification prior to making changes at the site which may alter the nature of the discharge	Notifications and site inspections	Yes
9. Limit on opacity of any discharge	Testing not undertaken during year under review	N/A
10. Limit on effect of emissions on PM10 concentration at the boundary	Testing not undertaken during year under review	N/A
11. Limits on other contaminants beyond site boundary	Testing not undertaken during year under review	N/A
12. Notification in the event of unauthorised discharge	No unauthorised incidents logged during the year	N/A
13. Optional review provision	Next option for review in June 2014	N/A
Overall assessment of consent compliance and environmental performance in respect of this consent		High

N/A = not applicable

During the year, the Company demonstrated a high level of environmental performance and compliance with the resource consents as defined in Section 1.1.4. The site was well managed and there were no incidents that required additional investigation.

3.4 Recommendations from the 2010-2012 Report

In the 2010-2012 Report, it was recommended:

1. THAT monitoring of consented activities at MAS Ltd in the 2012-2013 year be amended from that undertaken in 2010-2012, by replacing sample collection

previously carried out by MAS Ltd with quarterly combined discharge and receiving water sampling undertaken by the Council.

This recommendation was implemented.

3.5 Alterations to monitoring programme for 2013-2014

In designing and implementing the monitoring programmes for air/water discharges in the region, the Taranaki Regional Council has taken into account the extent of information made available by previous authorities, its relevance under the Resource Management Act, the obligations of the Act in terms of monitoring emissions/discharges and effects, and subsequently reporting to the regional community. The Council also takes into account the scope of assessments required at the time of renewal of permits, and the need to maintain a sound understanding of industrial processes within Taranaki emitting to the atmosphere/discharging to the environment.

It is proposed that for 2013-2014 monitoring of consented activities at the MAS Ltd site continues at the same level as in 2012-2013. A recommendation to this effect is attached to this report.

3.6 Exercise of optional review of consents

Resource consents 1857-6 and 4034-3 provide for optional review of the consents in June 2014. Conditions 9 and 13, respectively, allow the Council to review the consents for the purpose of ensuring that the conditions are adequate to deal with any adverse effects on the environment arising from the exercise of these resource consents which were either not foreseen at the time the applications were considered or which it was not appropriate to deal with at the time.

Based on the results of monitoring in the year under review, and in previous years as set out in earlier annual compliance monitoring reports, it is considered that there are no grounds that require a review to be pursued or grounds to exercise the review option for either of these consents.

A recommendation to this effect is presented in Section 4 of this report.

4. Recommendations

1. THAT monitoring of consented activities at the MAS Ltd site in the 2013-2014 year continues at the same level as in 2012-2013.
2. THAT the option for review of resource consents 1857-6 and 4034-3 in June 2014, as set out in conditions 9 and 13, respectively, not be exercised on the grounds that the current conditions are considered adequate to deal with any adverse effects on the environment arising from the exercise of these resource consents.

Glossary of common terms and abbreviations

The following abbreviations and terms are used within this report:

Al*	aluminium
As*	arsenic
Biomonitoring	assessing the health of the environment using aquatic organisms
BOD	biochemical oxygen demand. A measure of the presence of degradable organic matter, taking into account the biological conversion of ammonia to nitrate
BODF	biochemical oxygen demand of a filtered sample
bund	a wall around a tank to contain its contents in the case of a leak
CBOD	carbonaceous biochemical oxygen demand. A measure of the presence of degradable organic matter, excluding the biological conversion of ammonia to nitrate
cfu	colony forming units. A measure of the concentration of bacteria usually expressed as per 100 millilitre sample
COD	chemical oxygen demand. A measure of the oxygen required to oxidise all matter in a sample by chemical reaction
Condy	conductivity, an indication of the level of dissolved salts in a sample, usually measured at 20°C and expressed in mS/m
Cu*	copper
Cumec	A volumetric measure of flow- 1 cubic metre per second (1 m ³ s ⁻¹)
DO	dissolved oxygen
DRP	dissolved reactive phosphorus
<i>E.coli</i>	<i>escherichia coli</i> , an indicator of the possible presence of faecal material and pathological micro-organisms. Usually expressed as colony forming units per 100 millilitre sample
Ent	enterococci, an indicator of the possible presence of faecal material and pathological micro-organisms. Usually expressed as colony forming units per 100 millilitre of sample
F	fluoride
FC	faecal coliforms, an indicator of the possible presence of faecal material and pathological micro-organisms. Usually expressed as colony forming units per 100 millilitre sample
fresh	elevated flow in a stream, such as after heavy rainfall
g/m ³	grams per cubic metre, and equivalent to milligrams per litre (mg/L). In water, this is also equivalent to parts per million (ppm), but the same does not apply to gaseous mixtures
incident	an event that is alleged or is found to have occurred that may have actual or potential environmental consequences or may involve non-compliance with a consent or rule in a regional plan. Registration of an incident by the Council does not automatically mean such an outcome had actually occurred
intervention	action/s taken by Council to instruct or direct actions be taken to avoid or reduce the likelihood of an incident occurring
investigation	action taken by Council to establish what were the circumstances/events surrounding an incident including any allegations of an incident
l/s	litres per second

MCI	macroinvertebrate community index; a numerical indication of the state of biological life in a stream that takes into account the sensitivity of the taxa present to organic pollution in stony habitats
mS/m	millisiemens per metre
mixing zone	the zone below a discharge point where the discharge is not fully mixed with the receiving environment. For a stream, conventionally taken as a length equivalent to 7 times the width of the stream at the discharge point
NH ₄	ammonium, normally expressed in terms of the mass of nitrogen (N)
NH ₃	unionised ammonia, normally expressed in terms of the mass of nitrogen (N)
NO ₃	nitrate, normally expressed in terms of the mass of nitrogen (N)
NTU	Nephelometric Turbidity Unit, a measure of the turbidity of water
O&G	oil and grease, defined as anything that will dissolve into a particular organic solvent (e.g. hexane). May include both animal material (fats) and mineral matter (hydrocarbons)
Pb*	lead
pH	a numerical system for measuring acidity in solutions, with 7 as neutral. Numbers lower than 7 are increasingly acidic and higher than 7 are increasingly alkaline. The scale is logarithmic i.e. a change of 1 represents a ten-fold change in strength. For example, a pH of 4 is ten times more acidic than a pH of 5
Physicochemical	measurement of both physical properties (e.g. temperature, clarity, density) and chemical determinants (e.g. metals and nutrients) to characterise the state of an environment
PM ₁₀	relatively fine airborne particles (less than 10 micrometre diameter)
resource consent	refer Section 87 of the RMA. Resource consents include land use consents (refer Sections 9 and 13 of the RMA), coastal permits (Sections 12, 14 and 15), water permits (Section 14) and discharge permits (Section 15)
RMA	Resource Management Act 1991 and including all subsequent amendments
SS	suspended solids
SQMCI	semi quantitative macroinvertebrate community index;
Temp	temperature, measured in °C (degrees Celsius)
Turb	turbidity, expressed in NTU
UI	Unauthorised Incident
UIR	Unauthorised Incident Register – contains a list of events recorded by the Council on the basis that they may have the potential or actual environmental consequences that may represent a breach of a consent or provision in a Regional Plan
Zn*	zinc

*an abbreviation for a metal or other analyte may be followed by the letters 'As', to denote the amount of metal recoverable in acidic conditions. This is taken as indicating the total amount of metal that might be solubilised under extreme environmental conditions. The abbreviation may alternatively be followed by the letter 'D', denoting the amount of the metal present in dissolved form rather than in particulate or solid form.

For further information on analytical methods, contact the Council's laboratory.

Bibliography and references

- Department of Health (1992): Public health guidelines for the safe use of sewage effluent and sewage sludge on land. Public Health Services Report.
- Taranaki Regional Council (1994): McKechnie Metals Group Resource Consent Monitoring Programme Annual Report 1992-93. Technical Report 93-41.
- Taranaki Regional Council (1995): McKechnie Pacific Limited Resource Consents Monitoring Programme Annual Report 1993-94. Technical Report 94-64.
- Taranaki Regional Council (1995): McKechnie Pacific Limited Plume Monitoring Investigation 1994-95. Technical Report 95-10.
- Taranaki Regional Council (1996): McKechnie Pacific Limited Resource Consents Monitoring Programme Report 1994/95. Technical Report 95-77.
- Taranaki Regional Council (1996): McKechnie Pacific Limited Resource Consents Monitoring Programme Annual Report 1995-96. Technical Report 96-35.
- Taranaki Regional Council (1997): McKechnie Pacific Limited Plume Monitoring Investigation 1996-97. Technical Report 97-28.
- Taranaki Regional Council (1998): McKechnie Pacific Limited Resource Consents Monitoring Programme Annual Report 1996-97. Technical Report 97-53.
- Taranaki Regional Council (1999): McKechnie Pacific Limited Resource Consents Monitoring Programme Annual Report 1997-98. Technical Report 98-68.
- Taranaki Regional Council (2000): MCK Metals Pacific Limited Resource Consents Monitoring Programme Annual Report 1998-1999. Technical Report 99-98.
- Taranaki Regional Council (2000b): MCK Metals Pacific Limited Resource Consents Monitoring Programme Annual Report 1999-2000. Technical Report 2000-18.
- Taranaki Regional Council (2002): MCK Metals Pacific Limited Resource Consents Monitoring Programme Annual Report 2000-2001. Technical Report 2001-84.
- Taranaki Regional Council (2003): MCK Metals Pacific Limited Resource Consents Monitoring Programme Annual Report 2001-2002. Technical Report 2002-43.
- Taranaki Regional Council (2003): MCK Metals Pacific Limited Resource Consents Monitoring Programme Annual Report 2002-2003. Technical Report 2003-41.
- Taranaki Regional Council (2005): MCK Metals Pacific Limited Resource Consents Monitoring Programme Annual Report 2003-2004. Technical Report 2004-34.
- Taranaki Regional Council (2005): MCK Metals Pacific Limited Resource Consents Monitoring Programme Annual Report 2004-2005. Technical Report 2005-59.

Taranaki Regional Council (2007): MCK Metals Pacific Limited Resource Consents Monitoring Programme Annual Report 2005-2006. Technical Report 2006-06.

Taranaki Regional Council (2008): MCK Metals Pacific Limited Resource Consents Monitoring Programme Annual Report 2006-2007. Technical Report 2007-85.

Taranaki Regional Council (2009): MCK Metals Pacific Limited Monitoring Programme Annual Report 2007-2008. Technical Report 2008-66.

Taranaki Regional Council (2010): MCK Metals Pacific Limited Monitoring Programme Annual Report 2008-2009. Technical Report 2009-86.

Taranaki Regional Council (2012): McKechnie Aluminium Solutions Limited Monitoring Programme Annual Report 2009-2010. Technical Report 2010-112.

Taranaki Regional Council (2013): McKechnie Aluminium Solutions Limited Monitoring Programme Biennial Report 2010-2012. Technical Report 2012-75.

Appendix I

**Resource consents held by
McKechnie Aluminium Solutions Limited**

Discharge Permit
Pursuant to the Resource Management Act 1991
a resource consent is hereby granted by the
Taranaki Regional Council

Name of
Consent Holder: McKechnie Aluminium Solutions Limited
Private Bag 2007
NEW PLYMOUTH 4342

Decision Date: 4 December 2012

Commencement
Date: 4 December 2012

Conditions of Consent

Consent Granted: To discharge treated stormwater from an industrial premise that includes a metal extrusion plant into an unnamed tributary of the Mangaone Stream at or about (NZTM) 1698859E-5677985N

Expiry Date: 1 June 2026

Review Date(s): June 2014, June 2020 and in accordance with special condition 9

Site Location: 36 Paraitē Road, Bell Block, New Plymouth

Legal Description: Lot 1 DP 10008 Lot 1 DP 9212 Lot 2 DP 330342
[discharge source]

Catchment: Waiwhakaiho

Tributary: Mangaone

*For General, Standard and Special conditions
pertaining to this consent please see reverse side of this document*

General condition

- a. The consent holder shall pay to the Taranaki Regional Council [the Council] all the administration, monitoring and supervision costs of this consent, fixed in accordance with section 36 of the Resource Management Act.

Special conditions

- 1. The consent holder shall at all times adopt the best practicable option, as defined in section 2 of the Resource Management Act 1991, to prevent or minimise any adverse effects on the environment from the exercise of this consent.
- 2. The stormwater discharged shall be from a catchment area not exceeding 4 hectares.
- 3. Any significant volumes of hazardous substances on site shall be stored in a dedicated bunded area with drainage to sumps, or to other appropriate recovery systems, and not directly to the site stormwater system.
- 4. Constituents of the discharge shall meet the standards shown in the following table.

Constituent	Standard
pH	within the range 6.0 to 9.0
Suspended solids	concentration not greater than 100 gm ⁻³
Oil and grease	concentration not greater than 15 gm ⁻³
Dissolved copper	concentration not greater than 0.05 gm ⁻³
Dissolved zinc	concentration not greater than 1 gm ⁻³

This condition shall apply in the receiving waters at a designated sampling point immediately downstream of the railway crossing culvert at or about [1698859E-5677985N].

- 5. After allowing for reasonable mixing, within a mixing zone extending 150 metres downstream of the discharge point, the discharge shall not, either by itself or in combination with other discharges, give rise to any or all of the following effects in the receiving water:
 - a) the production of any conspicuous oil or grease films, scums or foams, or floatable or suspended materials;
 - b) any conspicuous change in the colour or visual clarity;
 - c) any emission of objectionable odour;
 - d) the rendering of fresh water unsuitable for consumption by farm animals;
 - e) any significant adverse effects on aquatic life.
- 6. The consent holder shall maintain a contingency plan that details measures and procedures to be undertaken to prevent spillage or any discharge of contaminants not authorised by this consent. The contingency plan shall be followed in the event of a spill or unauthorised discharge and shall be certified by the Chief Executive, Taranaki Regional Council as being adequate to avoid, remedy or mitigate the environmental effects of such a spillage or discharge.

7. The consent holder shall maintain a stormwater management plan that documents how the site is to be managed to minimise the contaminants that become entrained in the stormwater. This plan shall be followed at all times, shall be certified by the Chief Executive, Taranaki Regional Council, and shall include but not necessarily be limited to:
 - a) the loading and unloading of materials;
 - b) maintenance of conveyance systems;
 - c) general housekeeping; and
 - d) management of the interceptor system.


8. The consent holder shall notify the Chief Executive, Taranaki Regional Council, prior to making any changes to the processes or operations undertaken at the site, or the chemicals used or stored on site, or any disturbance of soil on site that could alter the nature of the discharge. Any such change shall then only occur following receipt of any necessary approval under the Resource Management Act. Notification shall include the consent number, a brief description of the activity consented and an assessment of the environmental effects of any changes, and be emailed to consents@trc.govt.nz.

9. In accordance with section 128 and section 129 of the Resource Management Act 1991, the Taranaki Regional Council may serve notice of its intention to review, amend, delete or add to the conditions of this resource consent by giving notice of review:
 - a) during the month of June 2014 and/or June 2020; and/or
 - b) within 3 months of receiving a notification under special condition 8 above;

for the purpose of ensuring that the conditions are adequate to deal with any adverse effects on the environment arising from the exercise of this resource consent, which were either not foreseen at the time the application was considered or which it was not appropriate to deal with at the time.

Signed at Stratford on 4 December 2012

For and on behalf of
Taranaki Regional Council

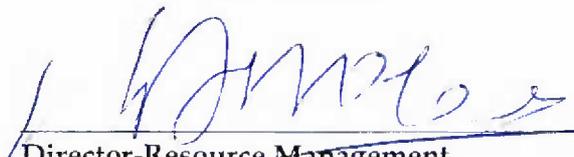
Director-Resource Management



CHIEF EXECUTIVE
PRIVATE BAG 713
47 CLOTEN ROAD
STRATFORD
NEW ZEALAND
PHONE: 06-765 7127
FAX: 06-765 5097
www.trc.govt.nz

Please quote our file number
on all correspondence

**Discharge Permit
Pursuant to the Resource Management Act 1991
a resource consent is hereby granted by the
Taranaki Regional Council**

Name of
Consent Holder: McKechnie Aluminium Solutions Limited
Private Bag 2007
NEW PLYMOUTH 4342

Consent Granted
Date: 15 August 2008

Conditions of Consent

Consent Granted: To discharge emissions into the air from extrusion and
remelting of aluminium and associated activities at or about
(NZTM) 1699193E-5678120N

Expiry Date: 1 June 2026

Review Date(s): June 2014, June 2020

Site Location: Paraitē Road, Bell Block, New Plymouth

Legal Description: Lot 1 DP 9212, Lot 1 DP 10008 & Lot 2 DP 330342

*For General, Standard and Special conditions
pertaining to this consent please see reverse side of this document*

Consent 4034-3

General conditions

- a) On receipt of a requirement from the Chief Executive, Taranaki Regional Council the consent holder shall, within the time specified in the requirement, supply the information required relating to the exercise of this consent.
- b) Unless it is otherwise specified in the conditions of this consent, compliance with any monitoring requirement imposed by this consent must be at the consent holder's own expense.
- c) The consent holder shall pay to the Council all required administrative charges fixed by the Council pursuant to section 36 in relation to:
 - i) the administration, monitoring and supervision of this consent; and
 - ii) charges authorised by regulations.

Special conditions

1. Notwithstanding any other conditions of this consent the consent holder shall at all times adopt the best practicable option, as defined in section 2 of the Resource Management Act 1991, to prevent or minimise any adverse effects on the environment from the exercise of this consent.
2. The consent holder shall minimise the emission and effects of contaminants discharged to air from the property, by the selection of the best practicable process equipment, process control equipment, contaminant abatement equipment, and methods of control, supervision and operation, and the proper and effective operation, supervision, control and maintenance of all equipment and processes at all times.
3. Any discharge to air from the exercise of this consent shall not give rise to any offensive, objectionable or toxic levels of smoke or dust or odour at or beyond the boundary of the property on which the extrusion and remelting of aluminium and associated activities are occurring.
4. The dust deposition rate beyond the property boundary of the MCK Metals Pacific Ltd Plant, arising from the discharge, shall be less than 4.0 g/m²/30 days or 0.13 g/m²/day.
5. All gas streams ventilated or otherwise discharged from the plant shall be treated to reduce the concentration of total particulate matter to less than 125 milligrams per cubic metre, normal temperature and pressure, at any time.

Consent 4034-3

6. The discharge of suspended particulate matter from the site shall not increase the ambient concentration of suspended particulate matter by more than 3 milligrams per cubic metre (measured under ambient conditions), determined by measurements at the upwind and downwind boundaries of the property.
7. The consent will be exercised in accordance with the procedures set out in the consent holder's Environmental Management Manual (August 2007) and subsequent revisions, and the consent holder shall subsequently adhere to and comply with the procedures, requirements, obligations and all other matters specified in the Environmental Management Manual (August 2007), except by specific agreement of the Chief Executive, Taranaki Regional Council. In the case of any contradiction between the Environmental Management Manual (August 2007) and the conditions of this resource consent, the conditions of this resource consent shall prevail.
8. The consent holder shall notify the Chief Executive, Taranaki Regional Council, prior to making any changes to the processes or operations undertaken at the site, or the chemicals used or stored on site, which could alter the nature of the discharge. Any such change shall then only occur following receipt of any necessary approval under the Resource Management Act. Notification shall include the consent number, a brief description of the activity consented and an assessment of the environmental effects of any changes, and to be emailed to worknotification@trc.govt.nz.
9. The opacity of any discharge to air when measured by photoelectric means shall not equal or exceed a value of 20% opacity.
10. The emissions to the air from the Consent Holder's premises shall not significantly contribute to, nor cause the monitored ground level concentrations of particulate material less than 10 microns in aerodynamic diameter to exceed 50 micrograms per cubic metre of air expressed as a 24 hour average at or beyond the boundary of Consent Holder's premises.
11. That the discharge to atmosphere of any contaminants other than those specified above shall not cause the concentration within the air space beyond the boundary of the Consent Holder's property of that contaminant to exceed 1/30th [one-thirtieth] of the relevant Workplace Exposure Standard Time-weighted average [Workplace Exposure Standards Effective from 2002].
12. The Consent Holder shall, for the purposes of adequately monitoring the consent as required under Section 35 of the Act, on becoming aware of any incident or situation that does not comply with this consent, immediately advise the Council on the incident. The Consent Holder shall then supply a written report to the Council on the cause, effects and the actions taken to mitigate the effects on the environment and to prevent recurrence. The written report shall be submitted to the Council within one week of the incident occurring.

Consent 4034-3

13. In accordance with section 128 and section 129 of the Resource Management Act 1991, the Taranaki Regional Council may serve notice of its intention to review, amend, delete or add to the conditions of this resource consent by giving notice of review during the month of June 2014 and/or June 2020, for the purpose of ensuring that the conditions are adequate to deal with any adverse effects on the environment arising from the exercise of this resource consent, which were either not foreseen at the time the application was considered or which it was not appropriate to deal with at the time.

Transferred at Stratford on 4 March 2010

For and on behalf of
Taranaki Regional Council



Director-Resource Management

Appendix II

Biomonitoring reports

To Job Manager, C MacKenzie
 From Scientific Officer, B Jansma
 File 03-02-005-07/01; 1857
 Report No BJ223
 Document No. 1294943
 Date 6 January 2014

Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, January 2013.

Introduction

The macroinvertebrate communities of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant have been monitored annually or biannually since November 1983. This biological survey was the second of two surveys scheduled in the 2012-2013 monitoring year. The results of surveys performed since the 1998-99 monitoring year are discussed in various Taranaki Regional Council reports (refer to the references).

Methods

The standard '400 ml sweep-net-sampling' technique was used to collect streambed macroinvertebrates from two established sites in the Mangaone Stream (Table 1, Figure 1) on 31 January 2013. The 'sweep-net sampling' technique is very similar to Protocol C2 (soft-bottomed, semi-quantitative) of the New Zealand Macroinvertebrate Working Group (NZMWG) protocols for macroinvertebrate samples in wadeable streams (Stark et al, 2001).

Table 1 Biomonitoring sites in the tributary of the Mangaone Stream that receives stormwater discharges from MCK Metals Pacific

Site No.	Site code	Map reference	Location
3	MGO 000031	P19: 086397	Below swamp (Sanger's intake)
4	MGO 000033	P19: 086395	400 metres downstream of site 3

Samples were preserved with Kahle's Fluid for later sorting and identification under a stereomicroscope according to Taranaki Regional Council methodology using protocol P1 of NZMWG protocols for sampling macroinvertebrates in wadeable streams (Stark et al. 2001). Macroinvertebrate taxa found in each sample were recorded as:

R (rare)	= less than 5 individuals;
C (common)	= 5-19 individuals;
A (abundant)	= estimated 20-99 individuals;
VA (very abundant)	= estimated 100-499 individuals;
XA (extremely abundant)	= estimated 500 individuals or more.

Stark (1985) developed a scoring system for macroinvertebrate taxa according to their sensitivity to organic pollution in stony New Zealand streams. Highly 'sensitive' taxa were assigned the highest scores of 9 or 10, while the most 'tolerant' forms scored 1. Sensitivity scores for certain taxa have been modified in accordance with Taranaki experience. Averaging the scores assigned to the taxa found at a site, and multiplying the average by a scaling factor of 20 produces a Macroinvertebrate Community Index (MCI) value.

The MCI was designed as a measure of the overall sensitivity of macroinvertebrate communities to the effects of organic pollution. MCI results can also reflect the effects of warm temperatures, slow current speeds and low dissolved oxygen levels, because the taxa capable of tolerating these conditions generally have low sensitivity scores. Usually more 'sensitive' communities (with higher MCI values) inhabit less polluted waterways. The use of this index in non-stony streams is possible if results are related to physical habitat (muddy or weedy streams tend to produce lower MCI values than stony streams).

A semi-quantitative MCI value (SQMCI_s) has also been calculated for the taxa present at each site by multiplying each taxon score by a loading factor (related to its abundance), totalling these products, and dividing by the sum of the loading factors (Stark, 1998 and 1999). The loading factors were 1 for rare (R), 5 for common (C), 20 for abundant (A), 100 for very abundant (VA) and 500 for extremely abundant (XA). Unlike the MCI, the SQMCI_s is not multiplied by a scaling factor of 20, therefore SQMCI_s values range from 1 to 10, while MCI values range from 20 to 200.

Results and discussion

The stormwater discharge from the MCK Metals Pacific plant flows into a small drain which itself flows into the eastern arm of a swampy area. The swamp forms the headwater of a small stream in which sites 3 and 4 are located. A long culvert was laid in the stream between sites 3 and 4 prior to the November 2000 survey (Figure 1). The culvert begins a few metres downstream of site 3 and ends at the point where site 4 was previously located. Site 4 was subsequently moved several metres downstream. The habitat at this location was similar to the habitat at the original site. There have also been changes in the headwaters of this unnamed tributary in relation to the construction of the bell block bypass.

It should be noted that the stream was culverted between sites 3 and 4 to allow the landowner to discharge cleanfill, in doing so, slowly filling in the gully. This site holds a consent to discharge this cleanfill, and is monitored under a separate monitoring programme. However, activities at this cleanfill site have the potential to impact on the communities of this stream. It should also be noted that a pollution incident was recorded against this cleanfill site shortly before the February 2011 survey. Although this discharge caused significant impacts on the instream fish and macroinvertebrate communities, the previous survey found that the macroinvertebrate communities of the stream had recovered to the point where these effects were no longer obvious.

During the current January 2013 survey, flows were low with both sites having a clear steady flow. The survey was performed around midday, and the water temperature had a narrow range, being 17.5°C at both sites. Substrate comprised predominantly silt at both sites.

Both sampling sites supported aquatic macrophytes, as is often typical of softer-bedded, slower-flowing habitats. These macrophytes provided partial shading of the bed at both sites, although no algae growth was noted. Some wood substrate was noted at site 3, while site 4 was very overgrown by terrestrial weeds, making it difficult to collect a sample.

Macroinvertebrate communities

The results of the previous macroinvertebrate surveys performed at sites 3 and 4 in the Mangaone tributary that receives stormwater discharges from MCK Metals Pacific are summarised in Table 2, together with the results of the current survey.

Table 2 Numbers of taxa and MCI values recorded in the unnamed tributary of the Mangaone Stream downstream of MCK Metals Pacific, from November 1983 to the current survey

Site	Number of previous surveys	Numbers of taxa			MCI values			SQMCIs			
		Range	Median	Current	Range	Median	Current	No.	Range	Median	Current
3	52	6-26	17	18	52-94	78	73	27	1.7-4.8	4.1	4.6
4	43	6-27	19	17	70-90	77	89	27	1.5-4.8	4.2	4.5

Table 3 Macroinvertebrate fauna of a tributary of Mangaone Stream in relation to MCK Metals sampled on 31 January 2013

Taxa List	Site Number	MCI score	3	4
	Site Code		MGO000031	MGO000033
	Sample Number		FWB13021	FWB13022
ANNELIDA (WORMS)	Oligochaeta	1	C	C
MOLLUSCA	Physa	3	R	-
	Potamopyrgus	4	XA	XA
CRUSTACEA	Ostracoda	1	C	-
	Isopoda	5	-	R
	Paracalliope	5	XA	VA
	Paraleptamphopidae	5	XA	XA
	Paranephrops	5	R	-
EPHEMEROPTERA (MAYFLIES)	Zephlebia group	7	-	R
ODONATA (DRAGONFLIES)	Xanthocnemis	4	C	-
HEMIPTERA (BUGS)	Microvelia	3	R	R
COLEOPTERA (BEETLES)	Hydrophilidae	5	-	R
TRICHOPTERA (CADDISFLIES)	Polypsectropus	6	C	R
	Psilochorema	6	-	R
	Oxyethira	2	R	-
	Tripletides	5	A	C
DIPTERA (TRUE FLIES)	Paralimnophila	6	-	R
	Orthoclaadiinae	2	R	-
	Polypedilum	3	-	C
	Tanypodinae	5	R	-
	Tanytarsini	3	R	-
	Paradixa	4	C	R
	Empididae	3	-	R
	Sciomyzidae	3	-	R
	Austrosimulium	3	C	-
ACARINA (MITES)	Acarina	5	R	A
		No of taxa	18	17
		MCI	73	89
		SQMCIs	4.6	4.5
		EPT (taxa)	2	4
		%EPT (taxa)	11	24
		'Tolerant' taxa	'Highly sensitive' taxa	
		'Moderately sensitive' taxa		

R = Rare C = Common A = Abundant VA = Very Abundant XA = Extremely Abundant

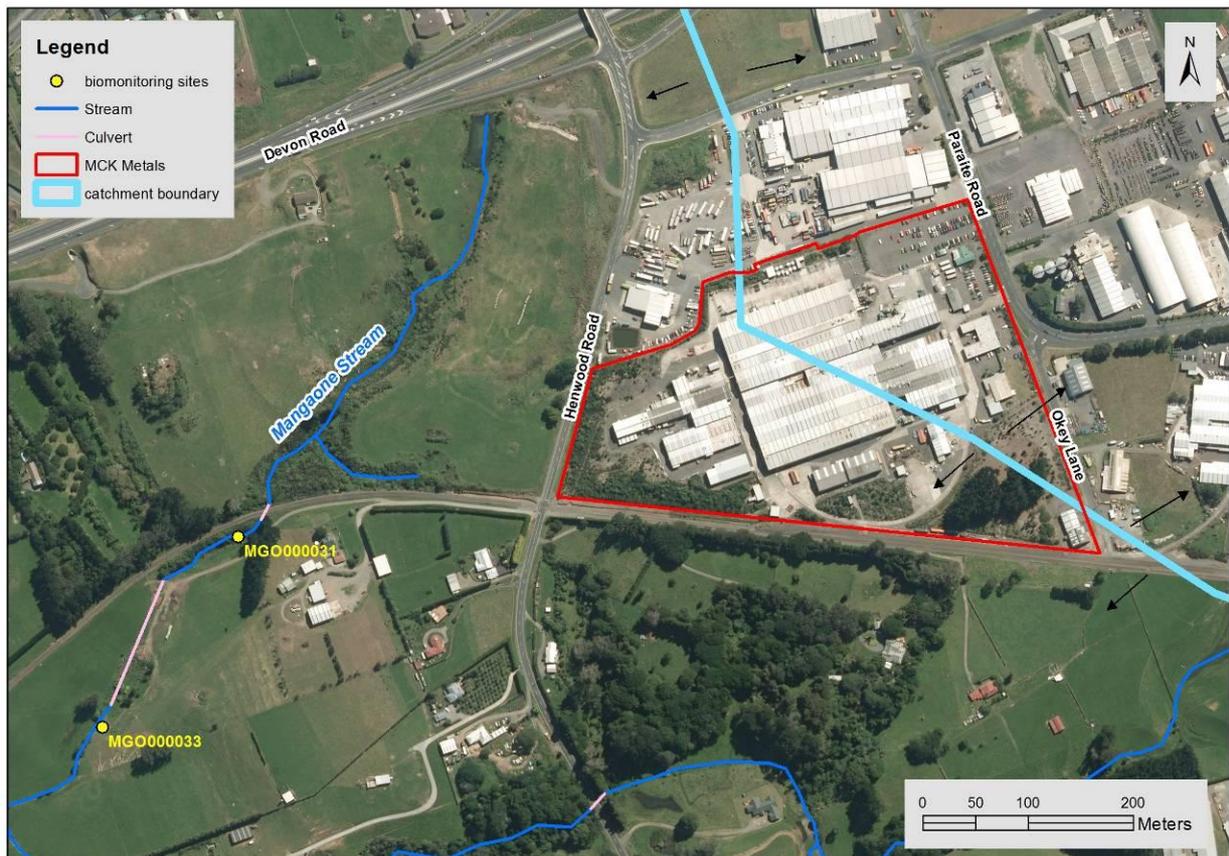


Figure 1 Biomonitoring sites in a tributary of the Mangaone Stream related to the stormwater discharge from MCK Metals Pacific

Site 3 (MGO000031)

A moderate richness of 18 taxa was found at site 3, one taxon more than the median richness found by previous surveys (Table 2). The community was dominated by a typical weedbed fauna including three ‘moderately sensitive’ taxa (amphipods (extremely abundant *Paracalliope* and paraleptamphopids) and stick-cased caddis (*Triplectides*)); and one ‘tolerant’ taxon (extremely abundant snail (*Potamopyrgus*)) (Table 3).

The moderate proportion of ‘tolerant’ taxa in the community (61% of richness) was reflected in the MCI score of 73 units which was five units less than the median of previously recorded scores, a statistically insignificant difference (Table 2 and Figure 2), and a score normally associated with weedy habitats that are in good condition. MCI scores have consistently been near to or above the median since 2000, although the current result is a sharp drop from that recorded in the most recent surveys (Figure 2). The SQMCI_s score of 4.6 was also typical of weedy habitats, and slightly higher than the long term median for this site due principally to the numerical dominance of two ‘moderately sensitive’ amphipod taxa.

Overall, this indicates that the community was in average to above average condition, and there is no indication that the stormwater discharge from the MCK Metals site has had any impact on this community.

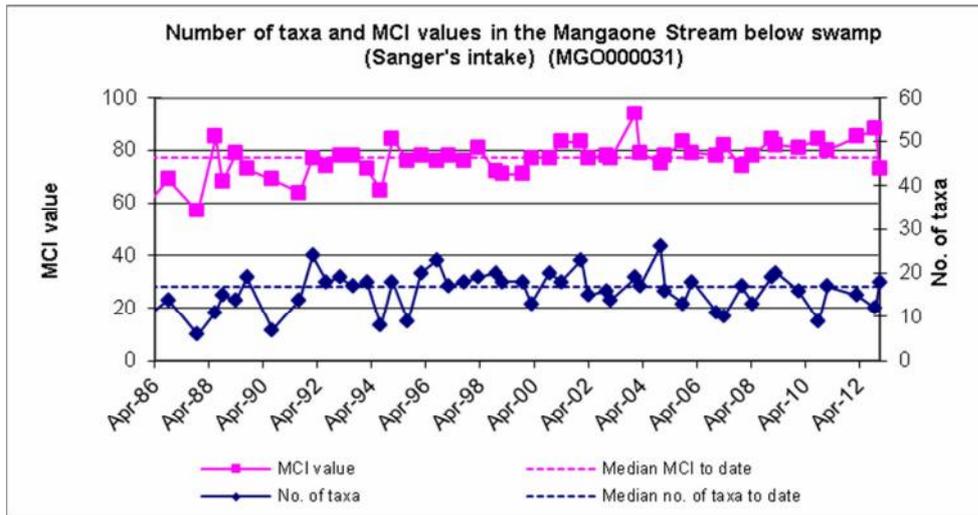


Figure 2 Taxa numbers and MCI scores recorded to date at site 3

Site 4 (MGO000033)

Community richness at site 4 (17 taxa) was two taxa lower than the median richness found by all previous surveys (Table 2, Figure 3) and similar to that recorded upstream in the current survey.

The absence of impacts from the MCK Metals stormwater discharge was also recorded at site 4, with the MCI score (89) being twelve units higher than the median, a statistically significant result, and reflecting the slightly lower proportion of ‘tolerant’ taxa present (41% of richness) in the community. The variability in numbers of taxa recorded at sites 3 and 4 in the Mangaone tributary to date is illustrated in Figure 4.

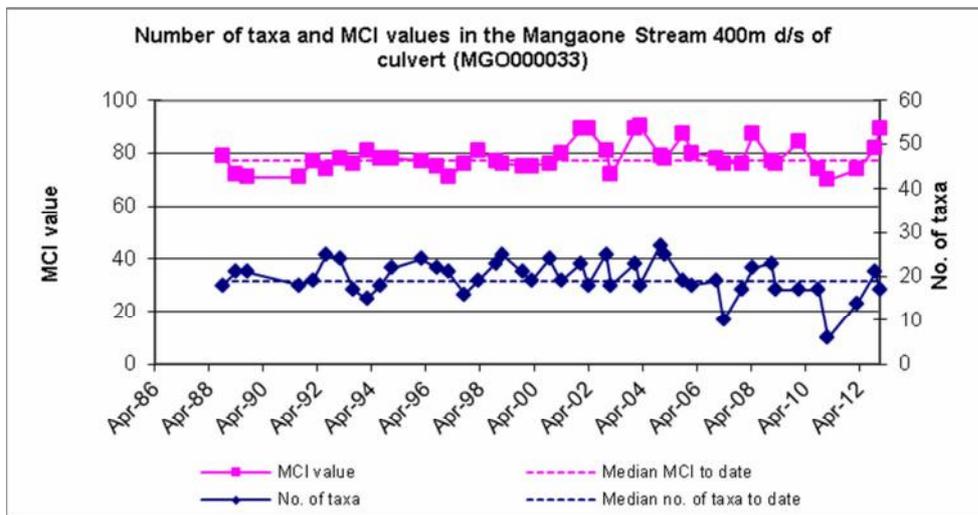


Figure 3 Taxa numbers and MCI scores recorded to date at site 4

Macroinvertebrate communities at site 3 (closer to the swampy headwaters and MCK stormwater discharge) have generally contained lower numbers of taxa than the communities at site 4 (see medians and ranges in Table 2), although this result was not repeated in the current survey. The lower numbers of taxa at site 3 may be explained by the close proximity of this site to the upstream swamp. The swampy habitat may not be a significant source of colonisation of stream invertebrates by means of downstream drift. In the current survey, community richness at site 3 was one taxon more, and at site 4 two taxa less, than their respective historical median values.

The site 4 community was dominated by the same taxa as those recorded upstream (Table 3), with the exception of *Triplectides* mayfly and the addition of 'moderately sensitive' mites. There were a small number of significant differences in individual taxon abundances between sites, reflecting only subtle differences in habitat between the sites. These changes had little effect on the SQMCI_s scores, which differed by only 0.1 unit between sites.

SQMCI_s values from both sites have generally varied between 4 and 5 units (particularly at site 4) in more recent surveys and this trend has continued in this survey. Slow-flowing, muddy-bedded and weedy stream macroinvertebrate communities most commonly produce SQMCI_s values in the range of 2 to 4 units. The abundances of 'moderately sensitive' taxa (eg amphipods) in this weedy stream increased these values toward the upper range found in most streams of this type. The recent increased abundances of such 'moderately sensitive' taxa suggest that water quality or habitat quality may have improved slightly during the past seven years (Figure 5), particularly at site 4.

Swampy habitats further upstream (Figure 1) were sampled between 1983 and March 1998. Site 1 was located in the eastern arm of the swamp, which receives stormwater discharges from MCK Metals, however this habitat dried up periodically. Site 2 was located in the northern arm of the swamp, upstream of the confluence with the discharge from MCK Metals. Sampling was discontinued at site 2 because of difficulty with access to the site. This site was sampled again in the summer 2007 survey, but access was still extremely difficult. Habitat at this site differed markedly to that at sites 3 and 4. These factors have resulted in the removal of this site from future surveys.

Previous surveys have compared relative abundances of certain taxa, and compared them with water quality, specifically dissolved zinc and copper. This comparison has now been discontinued, as the concentrations of dissolved zinc and copper at the sampled sites have not exceeded 50% of the LC50 toxicity limit for inanga and *Potamopyrgus* snails for over ten years.

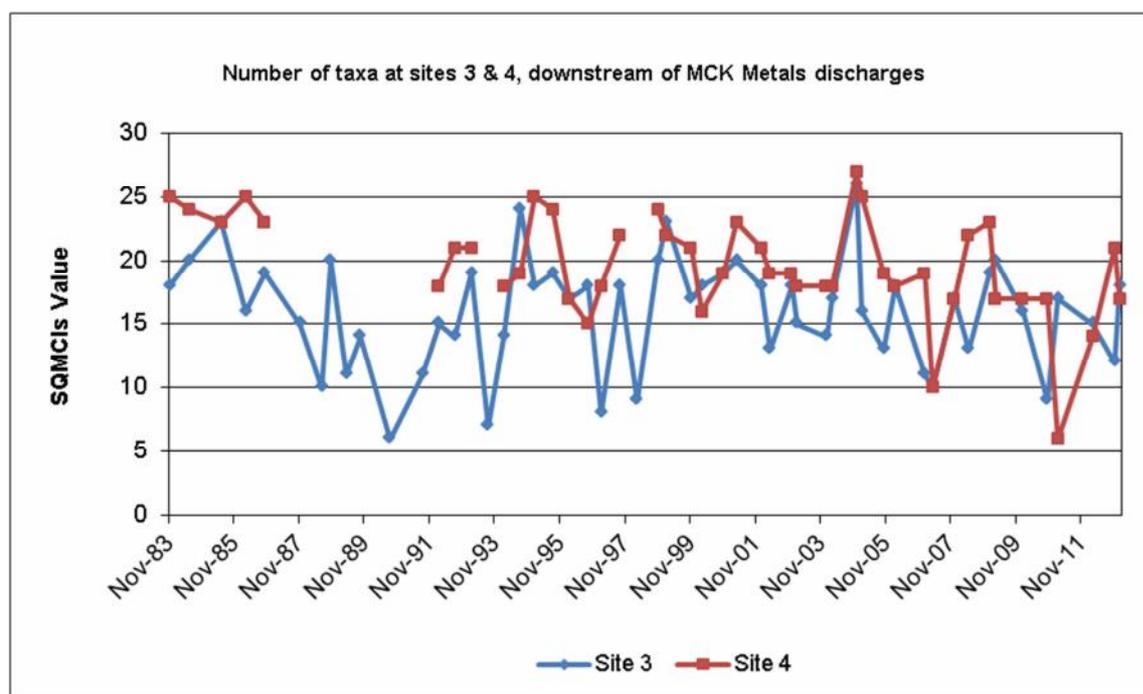


Figure 4 Number of taxa at sites 3 and 4 in an unnamed tributary of the Mangaone Stream in relation to discharges from MCK Metals Ltd

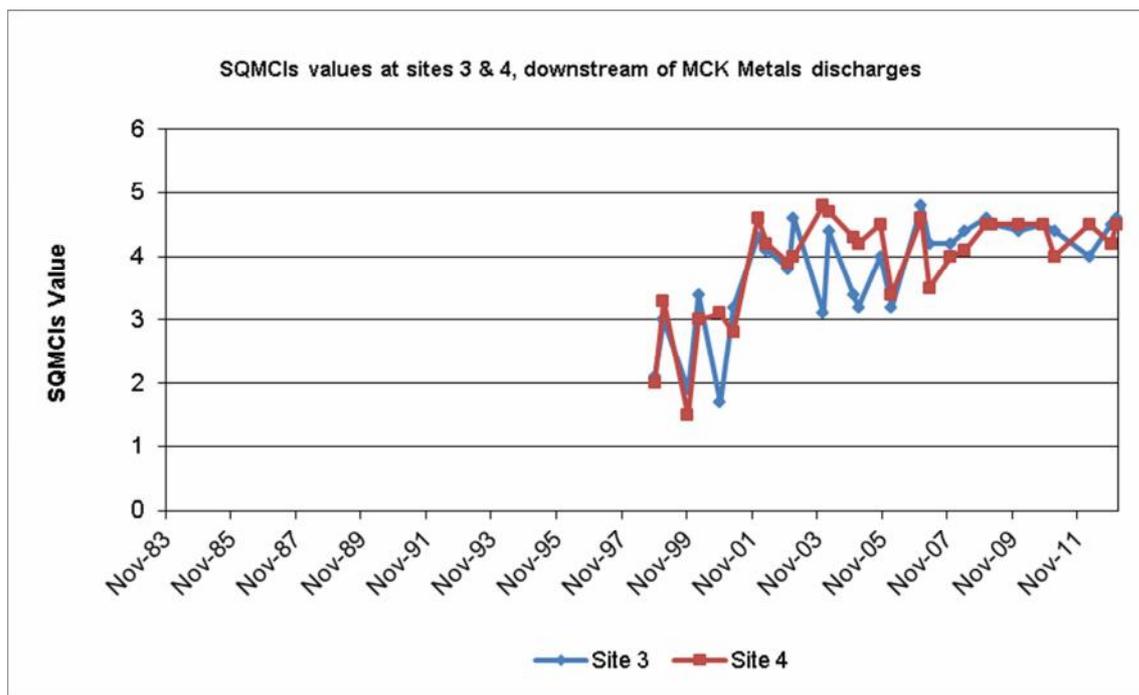


Figure 5 SQMCI_s values at sites 3 and 4 in an unnamed tributary of the Mangaone Stream in relation to discharges from MCK Metals Ltd

Summary and Conclusions

The Council’s standard ‘sweep sampling’ technique was used at two established sites to collect streambed macroinvertebrates from an unnamed tributary of the Mangaone Stream on 31 January 2013. Samples were sorted and identified to provide number of taxa (richness) and MCI and SQMCI_s scores.

The MCI is a measure of the overall sensitivity of the macroinvertebrate community to the effects of organic pollution in stony streams. It is based on the presence/absence of taxa with varying degrees of sensitivity to environmental conditions. The SQMCI_s takes into account taxa abundance as well as sensitivity to pollution, and may reveal more subtle changes in communities, particularly if non-organic impacts are occurring, and may be more useful in soft-bottomed streams. Significant differences in either the MCI or the SQMCI_s between sites may indicate the degree of adverse effects (if any) of the discharges being monitored.

The results of this biological survey indicated that the number of taxa recorded in the community a short distance downstream of the stormwater discharge from MCK Metals was moderate, being one taxon more than the historical median for this site. The community 400 metres further downstream was also relatively typical, having a macroinvertebrate richness two taxa less than the historical median. The upstream richness does not indicate an impact from the MCK metals discharge, but reflects the limited potential for recruitment from upstream, which has poor invertebrate habitat. The MCI value at site 3 was five units less than the median for this site, but well within the scores previous recorded. However, this result does represent large reduction from more recent surveys. The MCI score at site 4 was significantly higher than the median, and that recorded at site 3. It is unlikely the MCI score at site 3 indicates impacts from the stormwater discharge, as this site recorded a relatively healthy SQMCI_s score and community richness. In relation to historical survey results, the current survey results were indicative of no recent impacts of discharges on the macroinvertebrate communities of either site.

With the exception of the February 2006 and April 2007 surveys, the SQMCI values have been relatively high in the last 20 surveys. This was due mainly to the high abundances of medium-scoring taxa, particularly 'sensitive' amphipods. This trend was continued in the present survey at both sites. The generally higher SQMCI values in recent surveys may have indicated subtle improvements in the community from that recorded in the late 1990's. Although it is unlikely to be a significant change, it correlates with the improvement shown in the physicochemical water quality monitoring data over this time.

This macroinvertebrate survey indicated that the discharge of treated stormwater from the MCK Metals site had not had any detrimental effect on the macroinvertebrate community of this unnamed tributary.

References

- Dunning KJ, 2002a: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Ltd plant, January 2002. TRC report KD100.
- Dunning KJ, 2002b: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Ltd plant, April 2002. TRC report KD121.
- Fowles CR and Colgan BC, 2004: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Ltd plant, January 2004. TRC report CF321.
- Fowles CR, and Dunning KJ, 2003: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Ltd plant, December 2002. TRC report CF277.
- Fowles CR, and Hope KJ, 2005a: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Ltd plant, December 2004. TRC report CF363.
- Fowles CR, and Hope KJ, 2005b: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, February 2005. TRC report CF381.
- Fowles CR, and Jansma B, 2008a: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Pacific plant, December 2007. TRC CF460.
- Fowles CR, and Jansma B, 2008b: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Pacific plant, May 2008. TRC CF465.
- Fowles CR, and Moore, SC, 2004: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Pacific plant, March 2004. TRC report CF322.
- Hickey CW and Vickers ML, 1992: Comparison of the sensitivity to heavy metals and pentachlorophenol of the mayflies *Deleatidium* spp and the cladoceran *Daphnia magna*. *New Zealand Journal of Marine and Freshwater Research* 26: 87-93.
- Hope KJ, 2005: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, October 2005. TRC report KH056.
- Hope, KJ and Jansma, B, 2006: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, February 2006. TRC report KH086.

- Jansma B, 2007a: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, January 2007. TRC report BJ026.
- Jansma B, 2007b: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, April 2007. TRC report BJ028.
- Jansma B, 2009: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, January 2009. TRC report BJ082.
- Jansma B, 2009: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, March 2009. TRC Report BJ083.
- Jansma B, 2010: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, January 2010. TRC report BJ116.
- Jansma B, 2011: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, October 2010. TRC report BJ132.
- Jansma B, 2011: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, February 2011. TRC report BJ133.
- Jansma B, 2012: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, March 2012. BJ187.
- Jansma B, 2013: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, November 2012. BJ222.
- McWilliam H, 1999a: Biomonitoring of an unnamed tributary of the Mangaone Stream below the McKechnie Metals NZ Ltd plant, November 1998. TRC report HM155.
- McWilliam H, 1999b: Biomonitoring of an unnamed tributary of the Mangaone Stream below the McKechnie Metals NZ Ltd plant, February 1999. TRC report HM182.
- McWilliam H, 2000a: Biomonitoring of an unnamed tributary of the Mangaone Stream below the McKechnie Metals NZ Ltd plant, November 1999. TRC report HM206.
- McWilliam H, 2000b: Biomonitoring of an unnamed tributary of the Mangaone Stream below the McKechnie Metals NZ Ltd plant, March 2000. TRC report HM218.
- McWilliam H, 2001a: Biomonitoring of an unnamed tributary of the Mangaone Stream below the McKechnie Metals NZ Ltd plant, November 2000. TRC report HM240.
- McWilliam H, 2001b: Biomonitoring of an unnamed tributary of the Mangaone Stream below the McKechnie Metals NZ Ltd plant, April 2001. TRC report HM249.
- Moore SC, 2003: Biomonitoring of an unnamed tributary of the Mangaone Stream below the McKechnie Metals NZ Ltd plant, February 2003. TRC report SM581.
- Stark JD, 1985: A macroinvertebrate community index of water quality for stony streams. *Water and Soil* Miscellaneous Publication No. 87.

- Stark JD, 1998: SQMCI: a biotic index for freshwater macroinvertebrate coded abundance data. *New Zealand Journal of Marine and Freshwater Research* 32(1): 55-66.
- Stark JD, 1999: An evaluation of Taranaki Regional Council's SQMCI biomonitoring index. Cawthron Institute, Nelson. Cawthron Report No. 472.
- Stark JD, Boothroyd IKG, Harding JS, Maxted JR, Scarsbrook MR, 2001: Protocols for sampling macroinvertebrates in wadeable streams. New Zealand Macroinvertebrate Working Group Report No. 1. Prepared for the Ministry for the Environment. Sustainable Management Fund Project No. 5103. 57p.

To Job Manager, C MacKenzie
 From Scientific Officer, B Jansma
 File 03-02-005-07/01; 1857
 Report No BJ222
 Document No. 1290975
 Date 16 December 2013

Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, November 2012.

Introduction

The macroinvertebrate communities of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant have been monitored annually or biannually since November 1983. This biological survey was the first of two surveys scheduled in the 2012-2013 monitoring year. The results of surveys performed since the 1998-99 monitoring year are discussed in various Taranaki Regional Council reports (refer to the references).

This is the second survey undertaken since a pollution incident that occurred in February 2011. That spill resulted in a significant fish kill in the Mangaone Stream, and this survey will provide an indication of how recovery has progressed once this pollution was remediated.

Methods

The standard '400 ml sweep-net-sampling' technique was used to collect streambed macroinvertebrates from two established sites in the Mangaone Stream (Table 1, Figure 1) on 28 November 2012. The 'sweep-net sampling' technique is very similar to Protocol C2 (soft-bottomed, semi-quantitative) of the New Zealand Macroinvertebrate Working Group (NZMWG) protocols for macroinvertebrate samples in wadeable streams (Stark et al, 2001).

Table 1 Biomonitoring sites in the tributary of the Mangaone Stream that receives stormwater discharges from MCK Metals Pacific

Site No.	Site code	Map reference	Location
3	MGO 000031	P19: 086397	Below swamp (Sanger's intake)
4	MGO 000033	P19: 086395	400 metres downstream of site 3

Samples were preserved with Kahle's Fluid for later sorting and identification under a stereomicroscope according to Taranaki Regional Council methodology using protocol P1 of NZMWG protocols for sampling macroinvertebrates in wadeable streams (Stark et al. 2001). Macroinvertebrate taxa found in each sample were recorded as:

R (rare)	= less than 5 individuals;
C (common)	= 5-19 individuals;
A (abundant)	= estimated 20-99 individuals;
VA (very abundant)	= estimated 100-499 individuals;
XA (extremely abundant)	= estimated 500 individuals or more.

Stark (1985) developed a scoring system for macroinvertebrate taxa according to their sensitivity to organic pollution in stony New Zealand streams. Highly 'sensitive' taxa were assigned the highest scores of 9 or 10, while the most 'tolerant' forms scored 1. Sensitivity scores for certain taxa have been modified in accordance with Taranaki experience. Averaging

the scores assigned to the taxa found at a site, and multiplying the average by a scaling factor of 20 produces a Macroinvertebrate Community Index (MCI) value.

The MCI was designed as a measure of the overall sensitivity of macroinvertebrate communities to the effects of organic pollution. MCI results can also reflect the effects of warm temperatures, slow current speeds and low dissolved oxygen levels, because the taxa capable of tolerating these conditions generally have low sensitivity scores. Usually more 'sensitive' communities (with higher MCI values) inhabit less polluted waterways. The use of this index in non-stony streams is possible if results are related to physical habitat (muddy or weedy streams tend to produce lower MCI values than stony streams).

A semi-quantitative MCI value (SQMCI_s) has also been calculated for the taxa present at each site by multiplying each taxon score by a loading factor (related to its abundance), totalling these products, and dividing by the sum of the loading factors (Stark, 1998 and 1999). The loading factors were 1 for rare (R), 5 for common (C), 20 for abundant (A), 100 for very abundant (VA) and 500 for extremely abundant (XA). Unlike the MCI, the SQMCI_s is not multiplied by a scaling factor of 20, therefore SQMCI_s values range from 1 to 10, while MCI values range from 20 to 200.

Results and discussion

The stormwater discharge from the MCK Metals Pacific plant flows into a small drain which itself flows into the eastern arm of a swampy area. The swamp forms the headwater of a small stream in which sites 3 and 4 are located. A long culvert was laid in the stream between sites 3 and 4 prior to the November 2000 survey (Figure 1). The culvert begins a few metres downstream of site 3 and ends at the point where site 4 was previously located. Site 4 was subsequently moved several metres downstream. The habitat at this location was similar to the habitat at the original site. There have also been changes in the headwaters of this unnamed tributary in relation to the construction of the bell block bypass.

It should be noted that the stream was culverted between sites 3 and 4 to allow the landowner to discharge cleanfill, in doing so, slowly filling in the gully. This site holds a consent to discharge this cleanfill, and is monitored under a separate monitoring programme. However, activities at this cleanfill site have the potential to impact on the communities of this stream. It should also be noted that a pollution incident was recorded against this cleanfill site shortly before the February 2011 survey. It was found that on 9 February 2011, 5,500 litres of hydrolysed urea had been discharged to land at this cleanfill, where it had flowed to water. This discharge caused the deaths of many fish in the unnamed tributary and Mangaone Stream, and caused significant impacts on the invertebrate community at site 4.

During the current November 2012 survey, flows were moderate with both sites having a clear steady flow. The survey was performed in the early afternoon, and the water temperature had a relatively narrow range from 16.3°C to 16.4°C at these sites. Substrate comprised predominantly silt at both sites.

Both sampling sites supported aquatic macrophytes, as is often typical of softer-bedded, slower-flowing habitats. These macrophytes provided partial shading of the bed at site 3, although no algae growth was noted. At site 4, the macrophytes were on the edge of the stream only, but completely shaded the bed. As with site 3, no algal growth was observed.

Macroinvertebrate communities

The results of the previous macroinvertebrate surveys performed at sites 3 and 4 in the Mangaone tributary that receives stormwater discharges from MCK Metals Pacific are summarised in Table 2, together with the results of the current survey.

Table 2 Numbers of taxa and MCI values recorded in the unnamed tributary of the Mangaone Stream downstream of MCK Metals Pacific, from November 1983 to the current survey

Site	Number of previous surveys	Numbers of taxa			MCI values			SQMCI _s			
		Range	Median	Current	Range	Median	Current	No.	Range	Median	Current
3	51	6-26	17	12	52-94	77	88	26	1.7-4.8	4.1	4.5
4	42	6-27	19	21	70-90	77	82	26	1.5-4.8	4.2	4.2

Table 3 Macroinvertebrate fauna of a tributary of Mangaone Stream in relation to MCK Metals sampled on 28 November 2012

Taxa List	Site Number	MCI score	3	4
	Site Code		MGO000031	MGO000033
	Sample Number		FWB12457	FWB12458
NEMATODA	Nematoda	3	R	-
ANNELIDA (WORMS)	Oligochaeta	1	C	R
	Lumbricidae	5	R	-
MOLLUSCA	<i>Potamopyrgus</i>	4	XA	XA
CRUSTACEA	<i>Paracalliope</i>	5	C	VA
	Paraleptamphopidae	5	XA	VA
	Talitridae	5	-	R
	<i>Paranephrops</i>	5	-	R
ODONATA (DRAGONFLIES)	<i>Xanthocnemis</i>	4	-	C
HEMIPTERA (BUGS)	<i>Microvelia</i>	3	-	C
	<i>Saldula</i>	5	-	R
TRICHOPTERA (CADDISFLIES)	<i>Hydrobiosis</i>	5	-	R
	<i>Polypectropus</i>	6	-	R
	<i>Psilochorema</i>	6	R	C
	<i>Tripectides</i>	5	R	C
DIPTERA (TRUE FLIES)	<i>Paralimnophila</i>	6	R	-
	<i>Zelandotipula</i>	6	R	R
	Orthoclaadiinae	2	-	C
	<i>Polypedilum</i>	3	-	R
	<i>Paradixa</i>	4	-	R
	Empididae	3	-	A
	Ephydriidae	4	R	-
	Psychodidae	1	-	R
<i>Austrosimulium</i>	3	R	R	
ACARINA (MITES)	Acarina	5	-	C
No of taxa			12	21
MCI			88	82
SQMCI_s			4.5	4.2
EPT (taxa)			2	4
%EPT (taxa)			17	19
'Tolerant' taxa		'Moderately sensitive' taxa	'Highly sensitive' taxa	

R = Rare C = Common A = Abundant VA = Very Abundant XA = Extremely Abundant

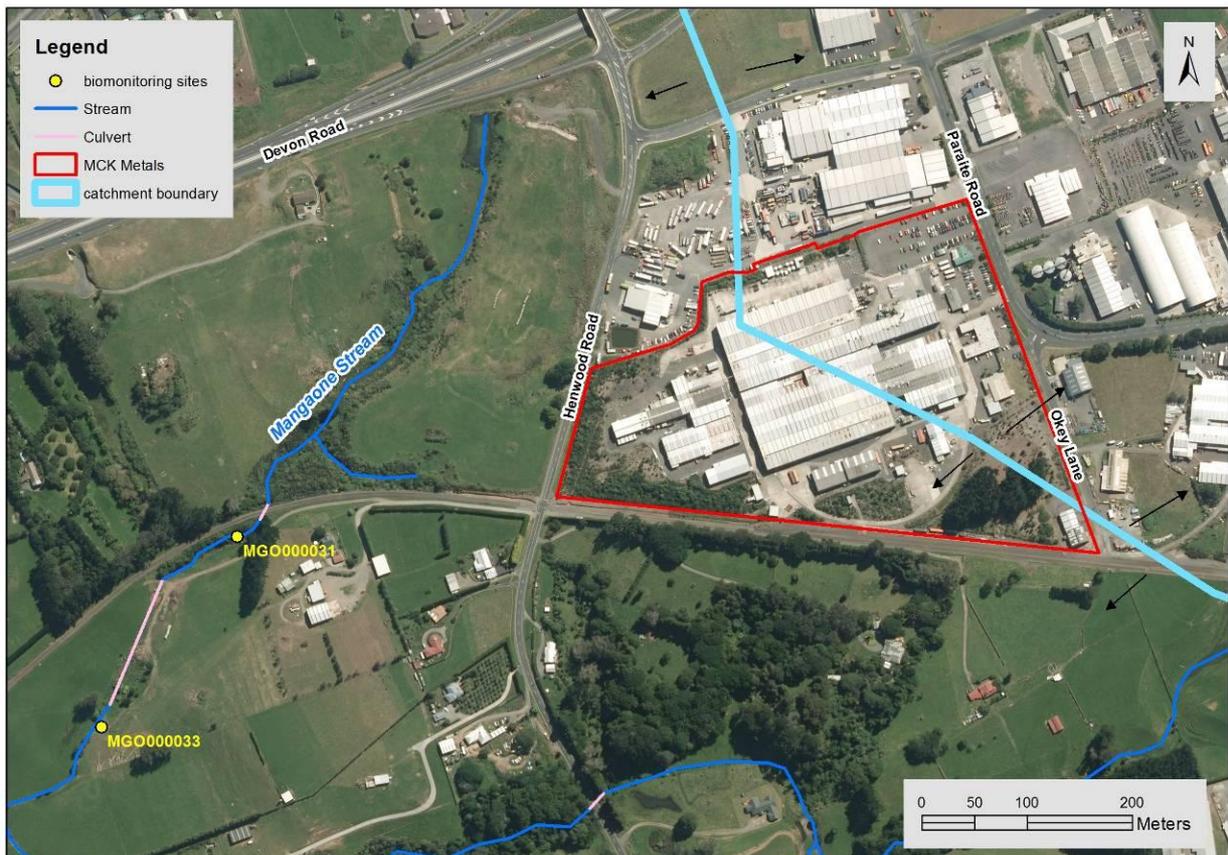


Figure 1 Biomonitoring sites in a tributary of the Mangaone Stream related to the stormwater discharge from MCK Metals Pacific

Site 3 (MGO000031)

A moderate richness of 12 taxa was found at site 3, five taxa less than the median richness found by previous surveys (Table 2). The community was dominated by a typical weedbed fauna including one 'moderately sensitive' taxon (amphipod (extremely abundant *paraleptamphopids*)); and one 'tolerant' taxon (extremely abundant snail (*Potamopyrgus*)) (Table 3).

The moderate proportion of 'tolerant' taxa in the community (42% of richness) was reflected in the MCI score of 88 units which was statistically significantly higher than the median of previously recorded scores (by eleven units) (Table 2 and Figure 2), and a score normally associated with weedy habitats that are in good condition. MCI scores have consistently been near to or above the median since 2000 (Figure 2). The SQMCI_s score of 4.5 was also typical of weedy habitats, and slightly higher than the long term median for this site due principally to the numerical dominance of 'moderately sensitive' amphipods.

Overall, this indicates that the community was in average to above average condition, and there is no indication that the stormwater discharge from the MCK Metals site has had any impact on this community.

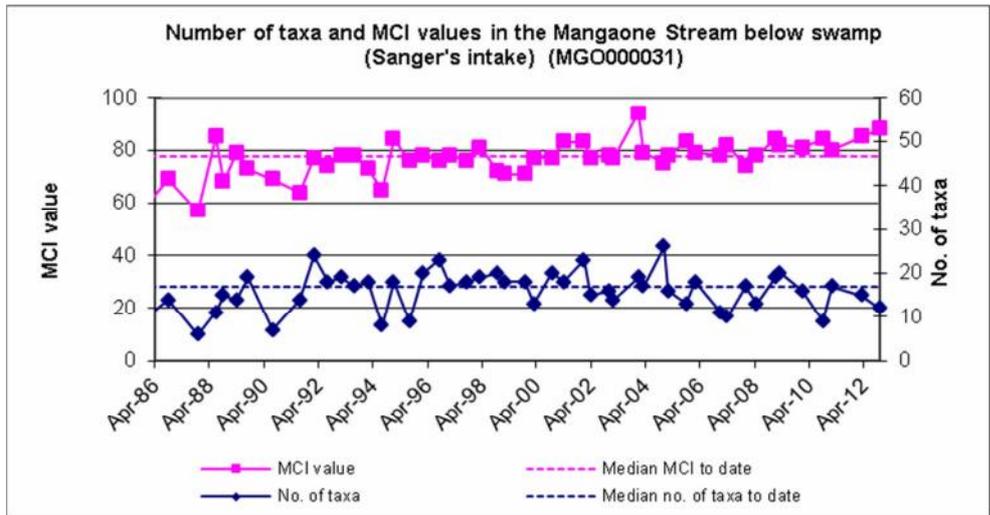


Figure 2 Taxa numbers and MCI scores recorded to date at site 3

Site 4 (MGO000033)

Community richness at site 4 (21 taxa) was two taxa higher than the median richness found by all previous surveys (Table 2, Figure 3) and nine taxa more than that recorded upstream in the current survey. Of note, is that this richness was 15 taxa more than that recorded at this site in the February 2011 survey, indicating continued recovery since the urea discharge. This result is slightly above average, and may indicate that the legacy of the urea discharge no longer exists.

The absence of impacts from the MCK Metals stormwater discharge was supported by the MCI score (82) which was five units higher than the median, and reflected the slightly higher proportion of ‘tolerant’ taxa present (48% of richness) in the community. This MCI score, when assessed against the community present, also reflected continued recovery since the urea discharge. The variability in numbers of taxa recorded at sites 3 and 4 in the Mangaone tributary to date is illustrated in Figure 4.

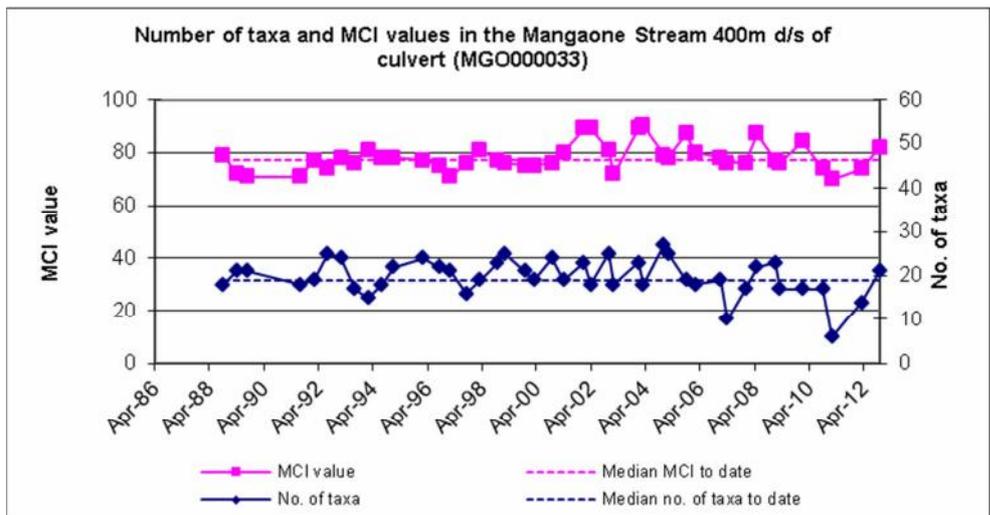


Figure 3 Taxa numbers and MCI scores recorded to date at site 4

Macroinvertebrate communities at site 3 (closer to the swampy headwaters and MCK stormwater discharge) have generally contained lower numbers of taxa than the communities at site 4 (see medians and ranges in Table 2), and this result was repeated in the current survey. The lower numbers of taxa at site 3 may be explained by the close proximity of this site to the upstream swamp. The swampy habitat may not be a significant source of

colonisation of stream invertebrates by means of downstream drift. In the current survey, community richness at site 3 was five taxa less, and at site 4 two taxa more, than their respective historical median values.

The site 4 community was dominated by the same taxa as those recorded upstream (Table 3), with the addition of 'moderately sensitive' *Paracalliope* amphipods and 'tolerant' empidid midge larvae. There were a small number of significant differences in individual taxon abundances between sites, reflecting the increased amount of habitat at site 4. These changes had little effect on the SQMCI_s scores, which differed by only 0.3 units between sites.

SQMCI_s values from both sites have generally varied between 4 and 5 units (particularly at site 4) in more recent surveys and this trend has continued in this survey. Slow-flowing, muddy-bedded and weedy stream macroinvertebrate communities most commonly produce SQMCI_s values in the range of 2 to 4 units. The abundances of 'moderately sensitive' taxa (eg amphipods) in this weedy stream increased these values toward the upper range found in most streams of this type. The recent increased abundances of such 'moderately sensitive' taxa suggest that water quality or habitat quality may have improved slightly during the past seven years (Figure 5), particularly at site 4.

Swampy habitats further upstream (Figure 1) were sampled between 1983 and March 1998. Site 1 was located in the eastern arm of the swamp, which receives stormwater discharges from MCK Metals, however this habitat dried up periodically. Site 2 was located in the northern arm of the swamp, upstream of the confluence with the discharge from MCK Metals. Sampling was discontinued at site 2 because of difficulty with access to the site. This site was sampled again in the summer 2007 survey, but access was still extremely difficult. Habitat at this site differed markedly to that at sites 3 and 4. These factors have resulted in the removal of this site from future surveys.

Previous surveys have compared relative abundances of certain taxa, and compared them with water quality, specifically dissolved zinc and copper. This comparison has now been discontinued, as the concentrations of dissolved zinc and copper at the sampled sites have not exceeded 50% of the LC50 toxicity limit for inanga and *Potamopyrgus* snails for over ten years.

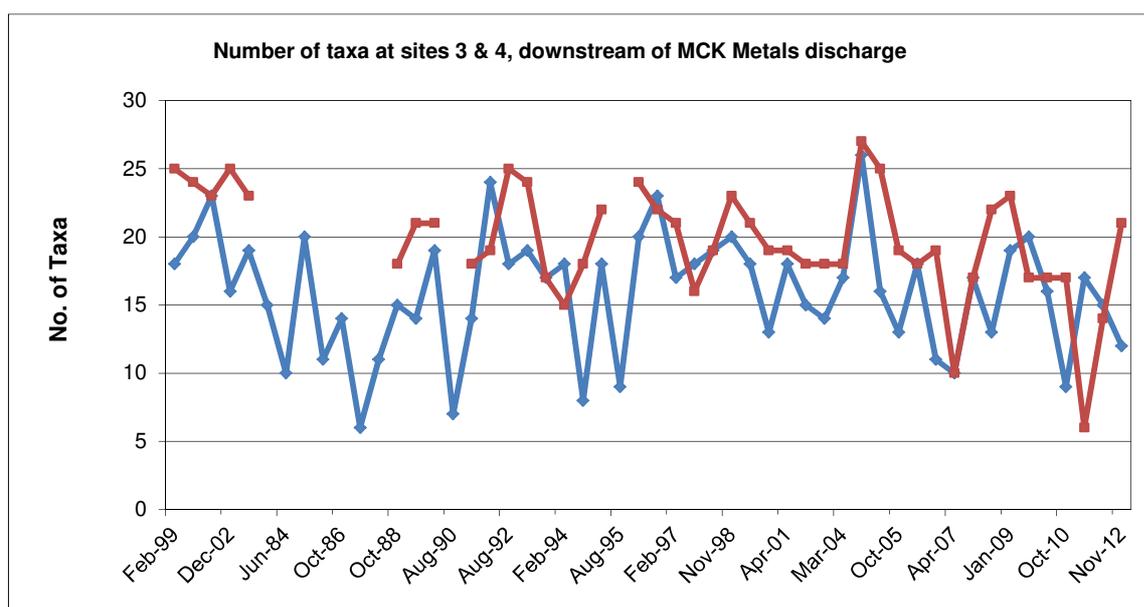


Figure 4 Number of taxa at sites 3 and 4 in an unnamed tributary of the Mangaone Stream in relation to discharges from MCK Metals Ltd

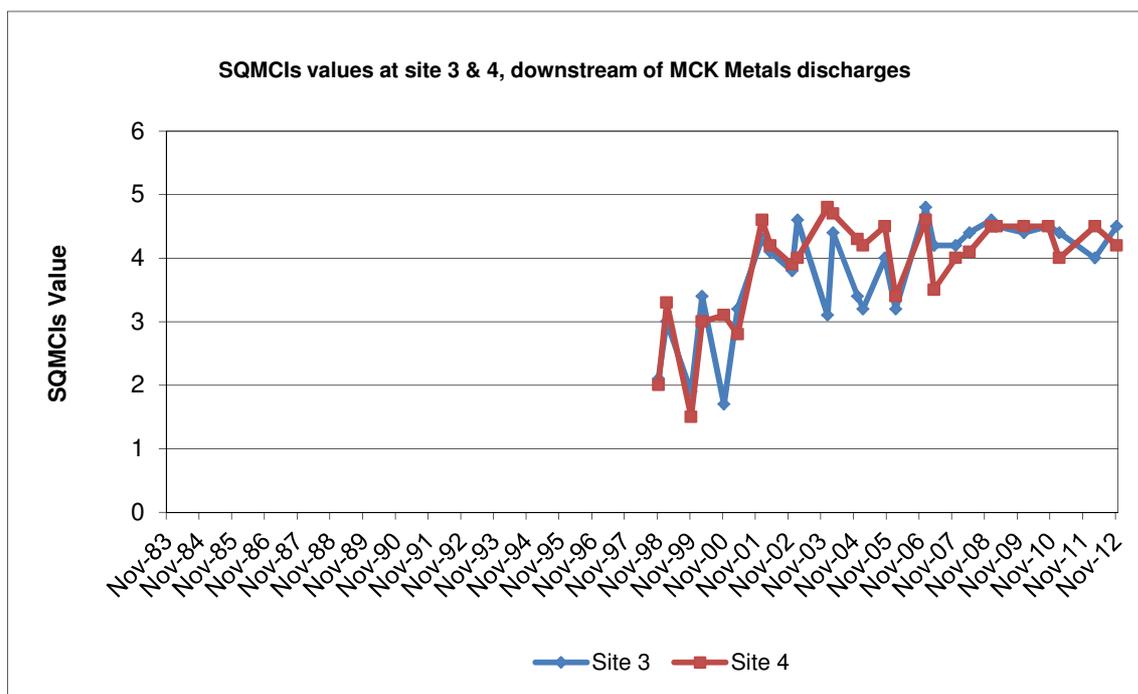


Figure 5 SQMCI₅ values at sites 3 and 4 in an unnamed tributary of the Mangaone Stream in relation to discharges from MCK Metals Ltd

Summary and Conclusions

The Council's standard 'sweep sampling' technique was used at two established sites to collect streambed macroinvertebrates from an unnamed tributary of the Mangaone Stream on 28 November 2012. Samples were sorted and identified to provide number of taxa (richness) and MCI and SQMCI₅ scores.

The MCI is a measure of the overall sensitivity of the macroinvertebrate community to the effects of organic pollution in stony streams. It is based on the presence/absence of taxa with varying degrees of sensitivity to environmental conditions. The SQMCI₅ takes into account taxa abundance as well as sensitivity to pollution, and may reveal more subtle changes in communities, particularly if non-organic impacts are occurring, and may be more useful in soft-bottomed streams. Significant differences in either the MCI or the SQMCI₅ between sites may indicate the degree of adverse effects (if any) of the discharges being monitored.

This is the third survey undertaken following a pollution incident that occurred in February 2012, which resulted in a significant fish kill in the Mangaone Stream, and the results of that survey reflected impacts from that pollution incident.

The results of this biological survey indicated that the number of taxa recorded in the community a short distance downstream of the stormwater discharge from MCK Metals was moderate, being only five taxa less than the historical median for this site. The community 400 metres further downstream was also relatively typical, having a macroinvertebrate richness two taxa higher than the historical median. This improved richness recorded at the downstream site indicates that the legacy from the urea discharge no longer exists. The upstream richness does not indicate an impact from the MCK metals discharge, but reflects the limited potential for recruitment from upstream, which has poor invertebrate habitat. The MCI values at both sites were greater than historical medians, with a six unit decrease between sites 3 and 4, which is not a statistically significant difference. In

relation to historical survey results, the current survey results were indicative of no recent impacts of discharges on the macroinvertebrate communities of either site.

With the exception of the February 2006 and April 2007 surveys, the SQMCI values have been relatively high in the last 20 surveys. This was due mainly to the high abundances of medium-scoring taxa, particularly 'sensitive' amphipods. This trend was continued in the present survey at both sites. The generally higher SQMCI values in recent surveys may have indicated subtle improvements in the community from that recorded in the late 1990's. Although it is unlikely to be a significant change, it correlates with the improvement shown in the physicochemical water quality monitoring data over this time.

This macroinvertebrate survey indicated that the discharge of treated stormwater from the MCK Metals site had not had any detrimental effect on the macroinvertebrate community at site 3 in the unnamed tributary. In addition, it appears that the impacts of the discharge of hydrolysed urea that occurred in February 2011 are no longer present, although the low community richness recorded at site 4 may be a remnant impact from that discharge.

References

- Dunning KJ, 2002a: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Ltd plant, January 2002. TRC report KD100.
- Dunning KJ, 2002b: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Ltd plant, April 2002. TRC report KD121.
- Fowles CR and Colgan BC, 2004: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Ltd plant, January 2004. TRC report CF321.
- Fowles CR, and Dunning KJ, 2003: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Ltd plant, December 2002. TRC report CF277.
- Fowles CR, and Hope KJ, 2005a: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Ltd plant, December 2004. TRC report CF363.
- Fowles CR, and Hope KJ, 2005b: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, February 2005. TRC report CF381.
- Fowles CR, and Jansma B, 2008a: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Pacific plant, December 2007. TRC CF460.
- Fowles CR, and Jansma B, 2008b: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Pacific plant, May 2008. TRC CF465.
- Fowles CR, and Moore, SC, 2004: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals NZ Pacific plant, March 2004. TRC report CF322.
- Hickey CW and Vickers ML, 1992: Comparison of the sensitivity to heavy metals and pentachlorophenol of the mayflies *Deleatidium* spp and the cladoceran *Daphnia magna*. *New Zealand Journal of Marine and Freshwater Research* 26: 87-93.
- Hope KJ, 2005: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, October 2005. TRC report KH056.

- Hope, KJ and Jansma, B, 2006: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, February 2006. TRC report KH086.
- Jansma B, 2007a: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, January 2007. TRC report BJ026.
- Jansma B, 2007b: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, April 2007. TRC report BJ028.
- Jansma B, 2009: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, January 2009. TRC report BJ082.
- Jansma B, 2009: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, March 2009. TRC Report BJ083.
- Jansma B, 2010: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, January 2010. TRC report BJ116.
- Jansma B, 2011: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, October 2010. TRC report BJ132.
- Jansma B, 2011: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, February 2011. TRC report BJ133.
- Jansma B, 2012: Biomonitoring of an unnamed tributary of the Mangaone Stream below the MCK Metals Pacific plant, March 2012. BJ187.
- McWilliam H, 1999a: Biomonitoring of an unnamed tributary of the Mangaone Stream below the McKechnie Metals NZ Ltd plant, November 1998. TRC report HM155.
- McWilliam H, 1999b: Biomonitoring of an unnamed tributary of the Mangaone Stream below the McKechnie Metals NZ Ltd plant, February 1999. TRC report HM182.
- McWilliam H, 2000a: Biomonitoring of an unnamed tributary of the Mangaone Stream below the McKechnie Metals NZ Ltd plant, November 1999. TRC report HM206.
- McWilliam H, 2000b: Biomonitoring of an unnamed tributary of the Mangaone Stream below the McKechnie Metals NZ Ltd plant, March 2000. TRC report HM218.
- McWilliam H, 2001a: Biomonitoring of an unnamed tributary of the Mangaone Stream below the McKechnie Metals NZ Ltd plant, November 2000. TRC report HM240.
- McWilliam H, 2001b: Biomonitoring of an unnamed tributary of the Mangaone Stream below the McKechnie Metals NZ Ltd plant, April 2001. TRC report HM249.
- Moore SC, 2003: Biomonitoring of an unnamed tributary of the Mangaone Stream below the McKechnie Metals NZ Ltd plant, February 2003. TRC report SM581.
- Stark JD, 1985: A macroinvertebrate community index of water quality for stony streams. *Water and Soil* Miscellaneous Publication No. 87.

- Stark JD, 1998: SQMCI: a biotic index for freshwater macroinvertebrate coded abundance data. *New Zealand Journal of Marine and Freshwater Research* 32(1): 55-66.
- Stark JD, 1999: An evaluation of Taranaki Regional Council's SQMCI biomonitoring index. Cawthron Institute, Nelson. Cawthron Report No. 472.
- Stark JD, Boothroyd IKG, Harding JS, Maxted JR, Scarsbrook MR, 2001: Protocols for sampling macroinvertebrates in wadeable streams. New Zealand Macroinvertebrate Working Group Report No. 1. Prepared for the Ministry for the Environment. Sustainable Management Fund Project No. 5103. 57p.